

French Quarter MANAGEMENT DISTRICT

French Quarter Sidewalk Assessment

2020 WALKING SURVEY • 1 APRIL 2020 – 10 NOVEMBER 2020

Compiled by: FQMD Livability Committee Members Dave Jorgensen & Kimberly Rosenberg

The French Quarter Management District is a State entity created by the Legislature as a means for the residential and business communities to work together to protect, preserve and maintain the world-famous French Quarter as a safe, clean, vibrant and friendly neighborhood for residents, business, and visitors.

The FQMD Board of Commissioners represent a diverse group of stakeholders who live, work, own property and/or businesses in the French Quarter, all of which are vested in protecting and improving the vitality, security and infrastructure of this gem of a neighborhood that supports the livelihood of our region's residents, the City and the State.

The FQMD works to:

- Improve public safety, foster quality experiences, and enhance quality of life within the District
- Improve commercial and residential vitality
- Strengthen the District as a vital component of Louisiana's tourism industry
- Aid in the preservation of the District's architecture, quaint charm, and *tout ensemble*
- Beautify the District's appearance

If you would like more information about the French Quarter Management District, please contact, our office by phone at 504-323-5801 or by e-mail at info@fqmd.org

Introduction

At the request of the New Orleans Mayor's Office, the Livability Committee of the French Quarter Management District (FQMD) updated prior assessed condition of the French Quarter (FQ) sidewalks. The prior assessment provided guidance but is replaced by this assessment in its entirety.

Assessment Rating

We scored the sidewalk hazards using the following tripping risk scale:

● **Red** – a Major hazard and in need of immediate repair, presents imminent hazard and obstructs pedestrian traffic. Violates standards set for access by persons with disabilities.

● **Orange** – a Moderate hazard that needs repair, impairs Handicap and pedestrian traffic, needs to be repaired but short of imminent danger to persons.

● **Yellow** – a Minor hazard that needs repair, but lower priority, this hazard does not impede Handicap but presents a continuing problem for pedestrians and will deteriorate further if not addressed.

Assessment Values

It was important in this walking survey to provided a comparative value for the deteriorating conditions of many of the walks in the FQ. These values are somewhat arbitrary but consistent throughout this survey. Meaning, that the values are a starting point to value different unique assessments to one another but are not intended to value the work or expense needed to correct the deficiency. The Values presented are intended to compare magnitude and provided a starting point for analysis of proper scope and efforts.

COSTS	Labor	\$42.50	UNIT	MHR / UNIT	LABOR & EQUIPMENT
Brick	Set up	\$85	\$4.00	1.00	Per brick foot
Concrete	Set up	\$105	\$8.00	1.5	Per square foot
Slate	Set up	\$125	\$12.00	2	Per tile 12x12 avg.

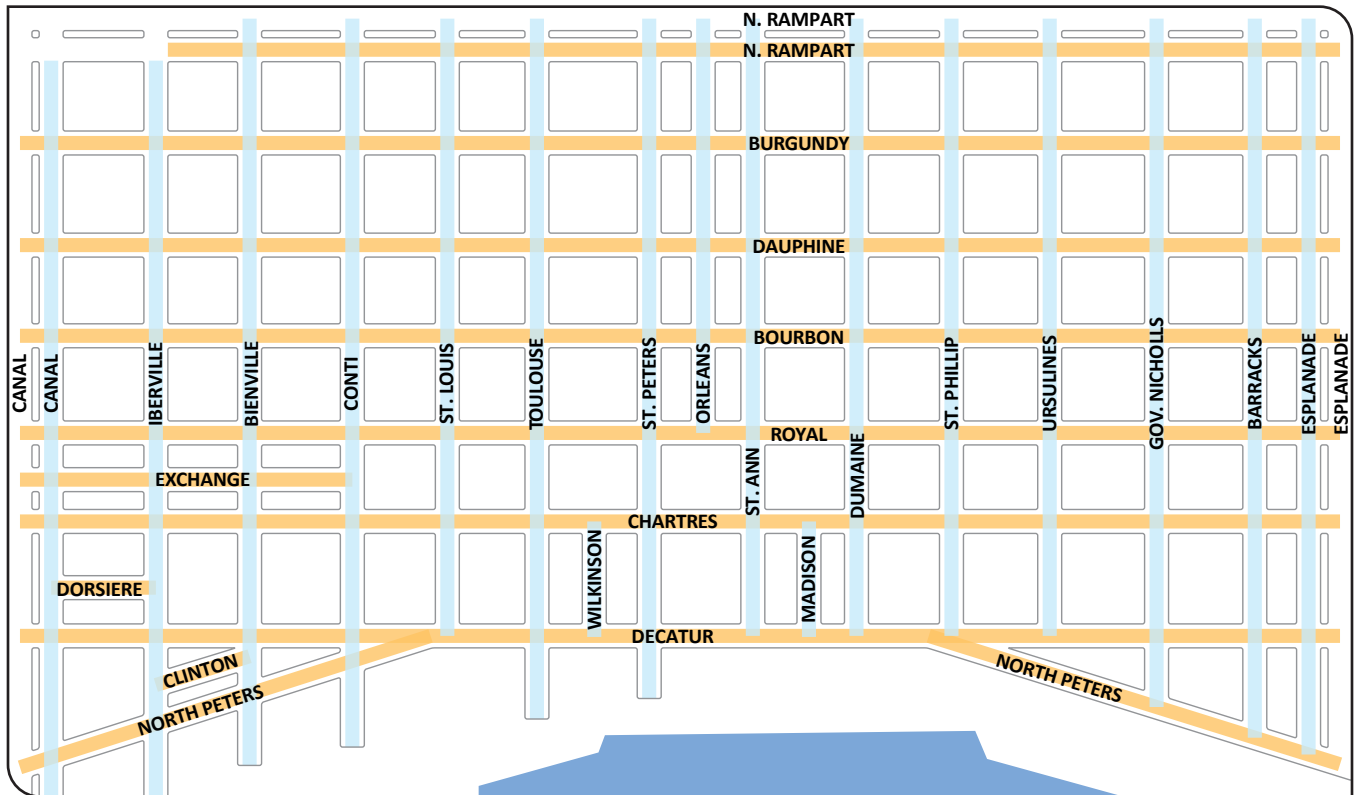


Figure 1. The 28 surveyed streets highlighted in orange and blue

Standards Used for this Survey

While we are aware of and understand Southern Building Codes and those requirements outlined by the Vieux Carré and the City of New Orleans, we did not evaluate compliance to these standards. It is likely that few of the sidewalks in the FQ (hold recent work on St. Ann, Bourbon and Canal Streets) would comply with these standards. This survey is not intended as a complete analysis of the faults in the sidewalks and curbs present in the FQ. The analysis is cursory and will require further evaluation by qualified contractors as to proper scope and costing for repair or replacement of these walks.

Summary of Findings

The walking evaluation included sidewalks from Rampart Street, Canal Street, and Esplanade Avenue for the sidewalks adjacent to the FQ and all the interior blocks to the Mississippi River excluding the River Walk. Each location identified on this survey may vary from a single missing brick or remnant of bolts protruding in walk to a length of walk and curb covering several municipal addresses. A total of 582 locations were identified as hazards and in need of repair and/or replacement:

SEVERITY	EST. COST
39 Major Hazard Locations	\$225,000
336 Moderate Hazard Locations	\$2,105,000
207 Minor Hazard Locations	\$555,000
Total 582 Hazard Locations	\$2,886,000

Source or potential responsibility for these conditions are as follows:

RESPONSIBILITY	LOCATIONS	EST. COST
Owner	8	\$77,000
Sewer & Water Board	142	\$333,000
Other/not determined	432	\$2,475,000
Total	582	\$2,886,000

Figure 2 represents the aggregate work outlined for each of the streets and cross streets in the French Quarter. The width of the bar indicates the estimated cost of repair for each of the streets reflecting the Major, Hazard and Minor conditions present on each street. Presently Ursuline Street needs major repairs (\$757,072.25) followed by lower Quarter Bourbon Street (\$222,771.75), Gov. Nichols Street

(\$285,749.50) and St Phillips Street (\$268,049.50). Much of the repair will require additional work on the roadway adjacent to the walks due to subsidence of soils supporting both the roadway and sidewalks in immediate area. This subsidence is likely caused by SWB water service to the FQ in old and leaking pipes. It was witnessed on multiple occasions clear water immersing from below the sidewalks or roadways under pressure. These incidents were reported via the SWB hotline.

Please note that an earlier survey of Governor Nichols and Barracks Street was conducted to assess the most needed repairs in the FQ. Both streets have repair work ongoing and this assessment did not include the prior cursory evaluation in the aggregate costs but

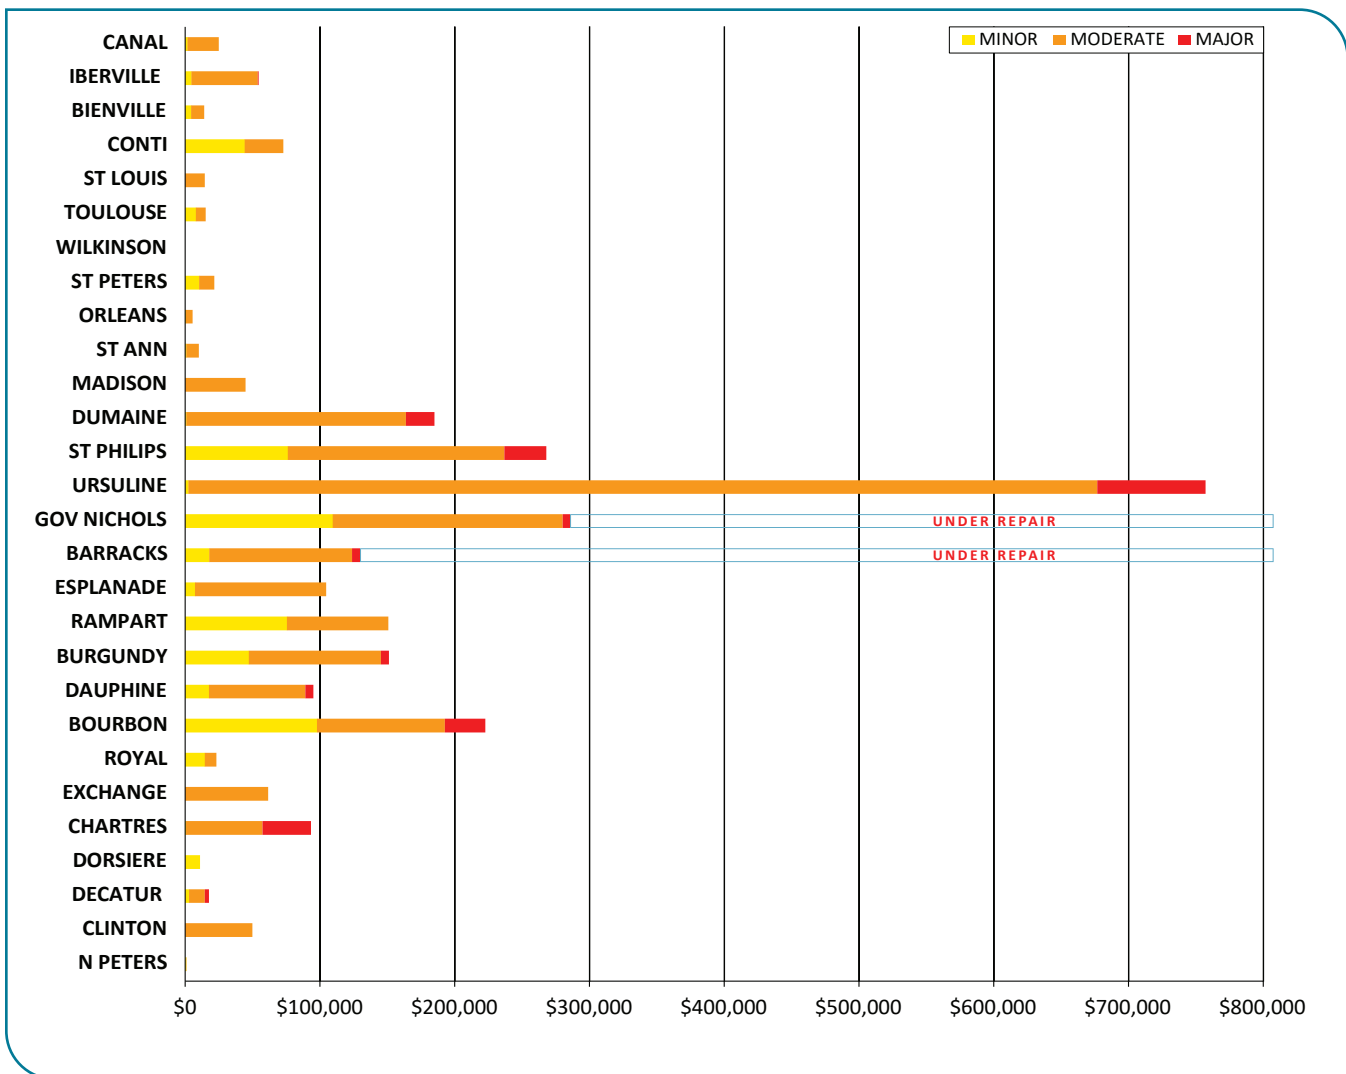
show the approximate values in Figure 2. Please note that that work is underway.

It is our recommendation that a follow-up survey assess conditions on a routine schedule (perhaps every two years) to advise the City and FQMD of the continuing need to address conditions of the walks and ways throughout the Quarter.

Contact Information

For technical questions related to the data in this report, please contact Dave Jorgensen of the FQMD Livability Committee at davejorgensen@gmail.com or 904-631-6880.

Figure 2. 2020 Survey Results



STREET	SEVERITY		
	MINOR	HAZARD	MAJOR
N PETERS	\$627.00	\$356.00	
CLINTON		\$49,968.75	
DECATUR	\$2,818.75	\$11,699.50	\$3,112.75
DORSIERE	\$10,730.00		
CHARTRES	\$711.00	\$56,648.00	\$35,932.75
EXCHANGE		\$61,528.75	
ROYAL	\$14,635.00	\$8,477.50	
BOURBON	\$97,834.75	\$94,843.25	\$30,093.75
DAUPHINE	\$17,617.00	\$71,490.50	\$5,968.00
BURGUNDY	\$47,348.00	\$97,880.75	\$5,908.75
RAMPART	\$75,410.75	\$75,423.75	
ESPLANADE	\$7,188.75	\$97,360.75	
BARRACKS	\$17,966.25	\$105,855.50	\$5,908.75
GOV NICHOLS	\$109,392.50	\$170,818.25	\$5,538.75
URSULINE	\$2,348.75	\$674,554.50	\$80,169.00
ST PHILIPS	\$76,082.00	\$160,797.75	\$31,169.75
DUMAINE	\$776.00	\$163,110.25	\$21,197.50
MADISON		\$44,812.50	
ST ANN	\$781.50	\$9,341.50	
ORLEANS	\$348.00	\$5,101.00	
ST PETERS	\$10,285.50	\$11,434.25	
WILKINSON			
TOULOUSE	\$7,872.50	\$7,362.00	
ST LOUIS		\$14,630.50	
CONTI	\$44,160.50	\$28,689.00	
BIENVILLE	\$4,455.50	\$9,644.50	
IBERVILLE	\$4,559.00	\$49,406.50	\$611.00
CANAL	\$1,815.00	\$23,117.00	
TOTAL	\$555,764.00	\$2,104,352.50	\$225,610.75
			GRAND TOTAL
			\$2,885,727.25

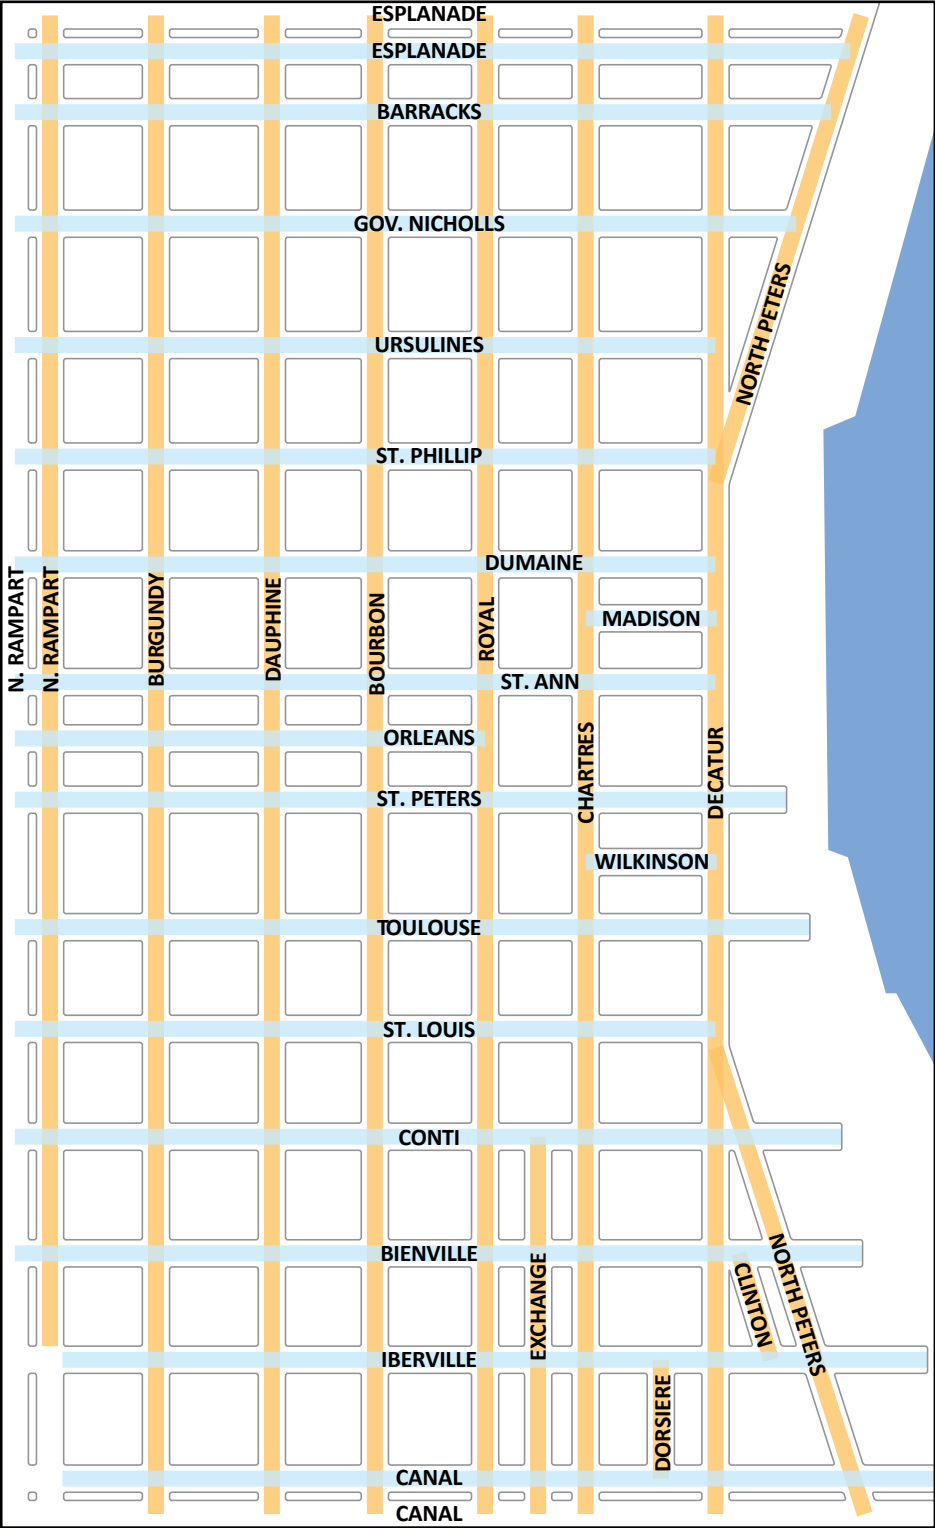
Figure 3. Numeric presentation of aggregate deficiencies noted in survey

APPENDIX:

2020 French Quarter Sidewalk Assessment

FULL REPORT

FQMD SIDEWALK SURVEY 2020



COST ASSUMPTIO NS	COSTS	LABOR	\$	42.50	UNIT	MHR / UNIT	
	BRICK	SET UP		\$85	\$	4.00	1.00
	CONC	SET UP		\$105	\$	8.00	1.5
	SLATE	SET UP		\$125	\$	12.00	2

\$ 2,885,727.25

- N PETERS
- CLINTON
- DECATUR
- DORSIERE
- CHARTRES
- EXCHANGE
- ROYAL
- BOURBON
- DAUPHINE
- BURGUNDY
- RAMPART
- ESPLANADE
- BARRACKS
- GOV NICHOLS
- URSULINE
- ST PHILIPS
- DUMAINE
- MADISON
- ST ANN
- ORLEANS
- ST PETERS
- WILKINSON
- TOULOUSE
- ST LOUIS
- CONTI
- BIENVILLE
- IBERVILLE
- CANAL
- TOTAL

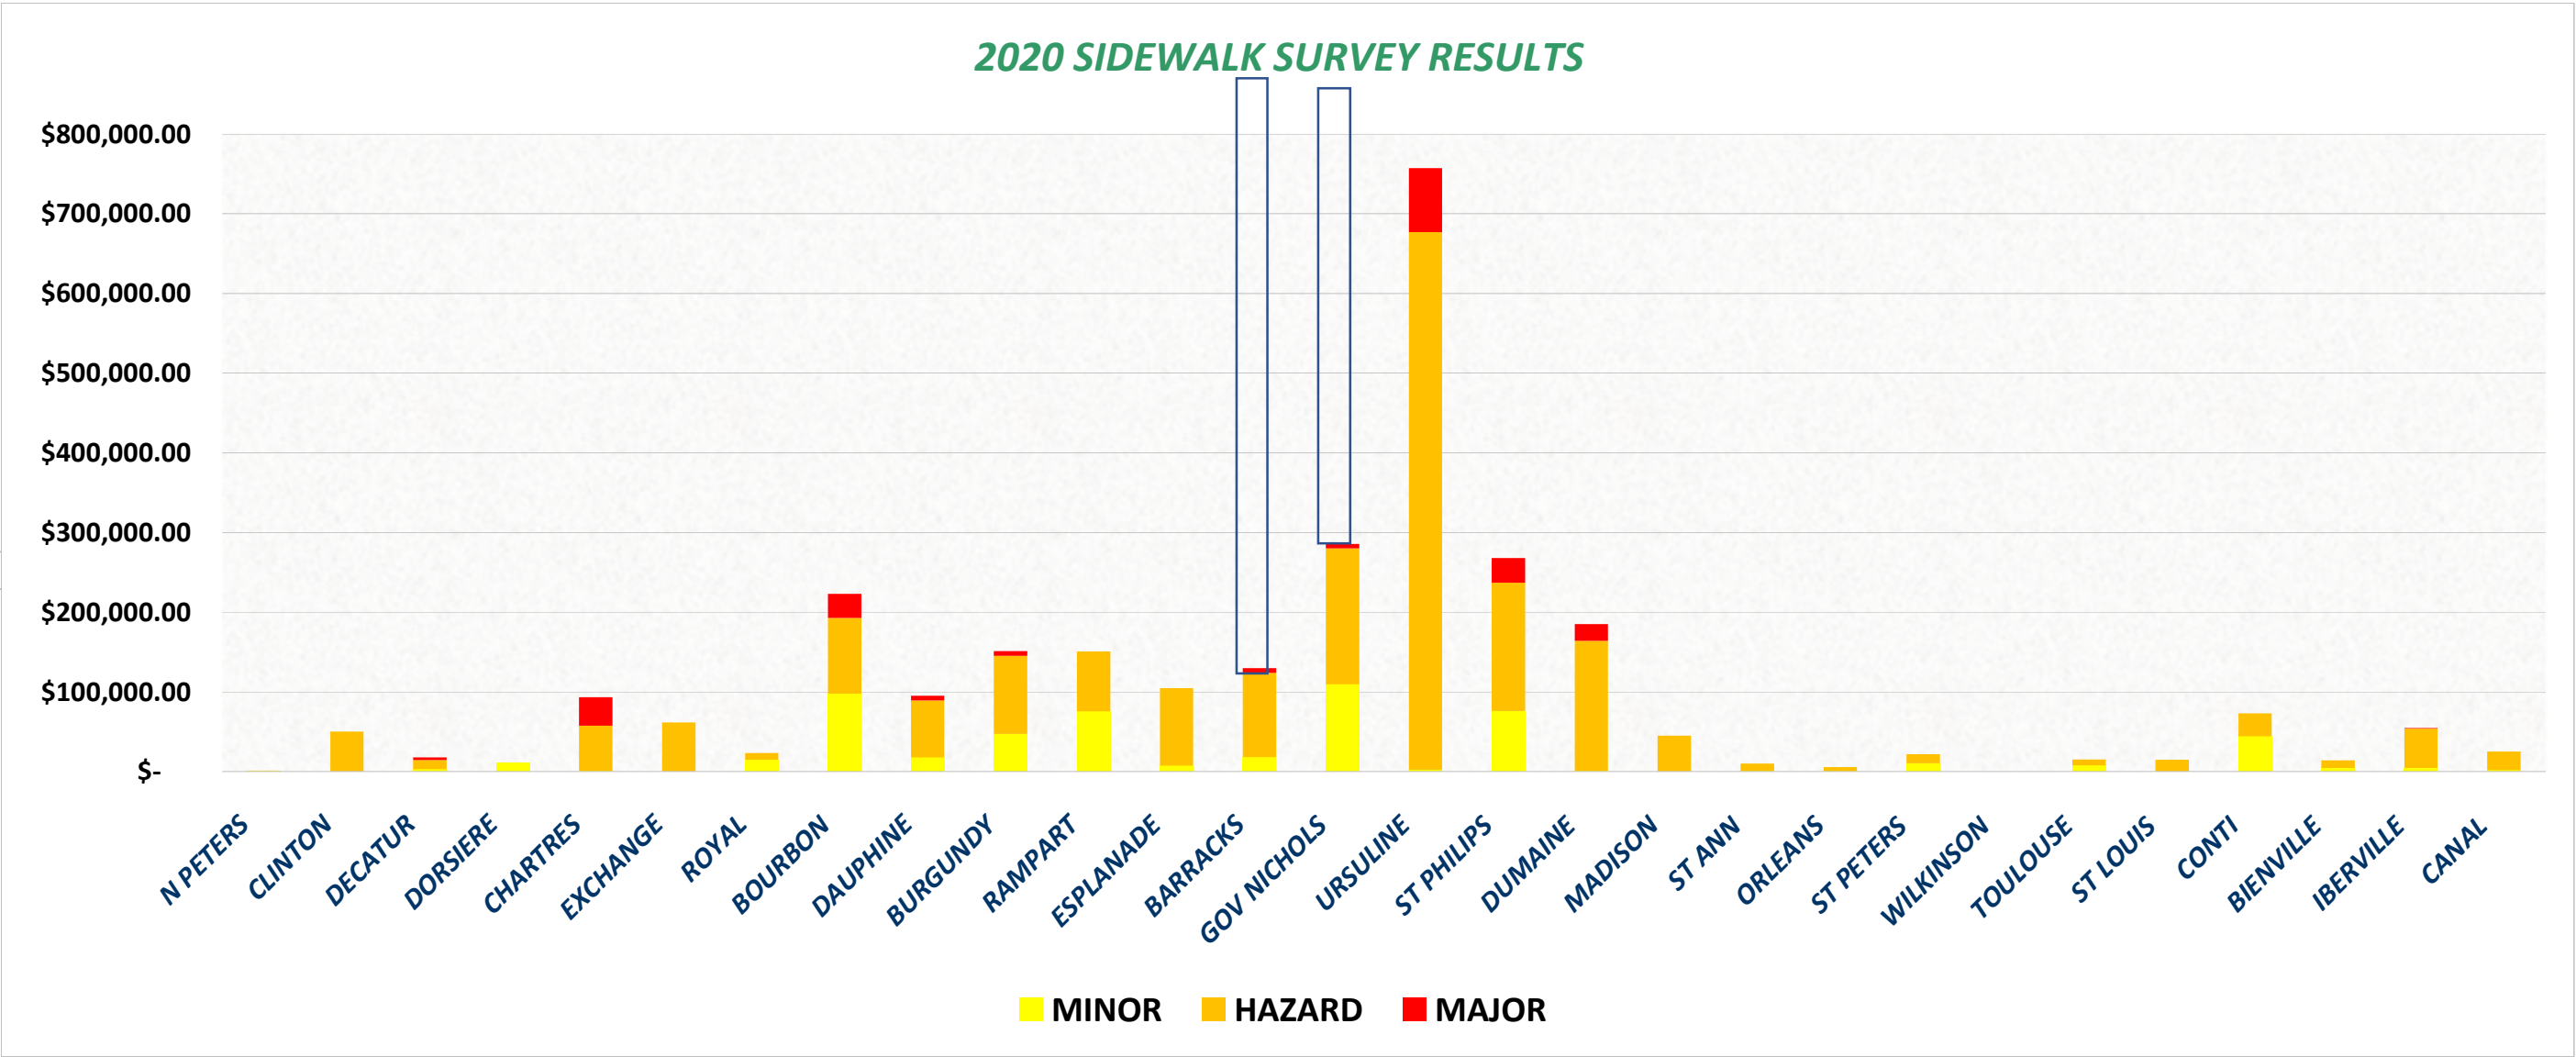
MINOR	HAZARD	MAJOR
\$ 627.00	\$ 356.00	\$ -
\$ -	\$ 49,968.75	\$ -
\$ 2,818.75	\$ 11,699.50	\$ 3,112.75
\$ 10,730.00	\$ -	\$ -
\$ 711.00	\$ 56,648.00	\$ 35,932.75
\$ -	\$ 61,528.75	\$ -
\$ 14,635.00	\$ 8,477.50	\$ -
\$ 97,834.75	\$ 94,843.25	\$ 30,093.75
\$ 17,617.00	\$ 71,490.50	\$ 5,968.00
\$ 47,348.00	\$ 97,880.75	\$ 5,908.75
\$ 75,410.75	\$ 75,423.75	\$ -
\$ 7,188.75	\$ 97,360.75	\$ -
\$ 17,966.25	\$ 105,855.50	\$ 5,908.75
\$ 109,392.50	\$ 170,818.25	\$ 5,538.75
\$ 2,348.75	\$ 674,554.50	\$ 80,169.00
\$ 76,082.00	\$ 160,797.75	\$ 31,169.75
\$ 776.00	\$ 163,110.25	\$ 21,197.50
\$ -	\$ 44,812.50	\$ -
\$ 781.50	\$ 9,341.50	\$ -
\$ 348.00	\$ 5,101.00	\$ -
\$ 10,285.50	\$ 11,434.25	\$ -
\$ -	\$ -	\$ -
\$ 7,872.50	\$ 7,362.00	\$ -
\$ -	\$ 14,630.50	\$ -
\$ 44,160.50	\$ 28,689.00	\$ -
\$ 4,455.50	\$ 9,644.50	\$ -
\$ 4,559.00	\$ 49,406.50	\$ 611.00
\$ 1,815.00	\$ 23,117.00	\$ -
\$ 555,764.00	\$ 2,104,352.50	\$ 225,610.75

\$ 2,885,727.25

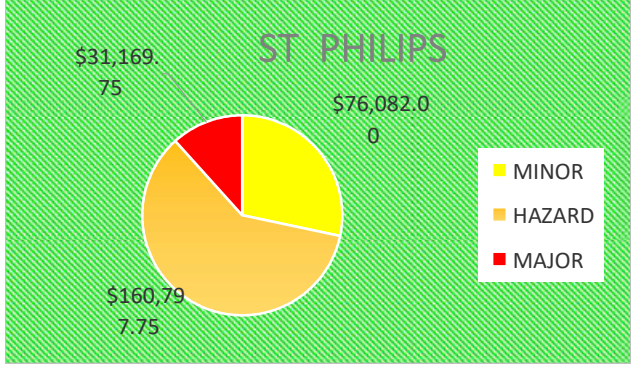
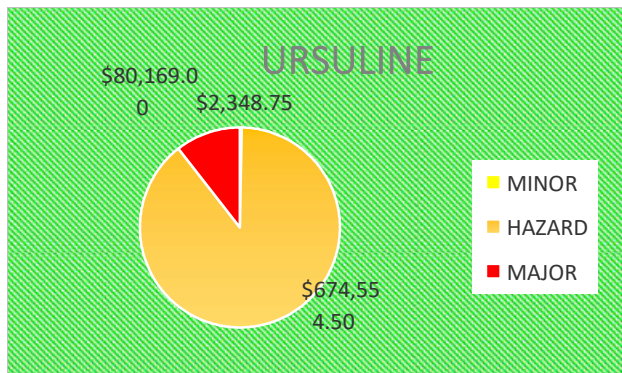
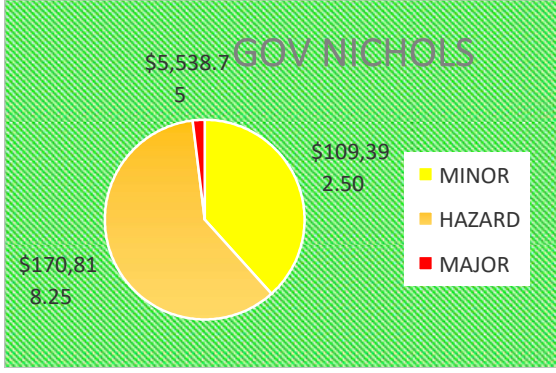
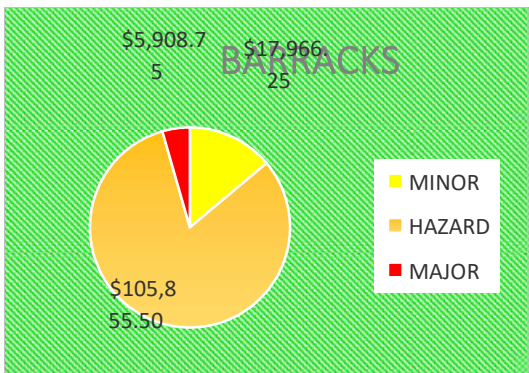
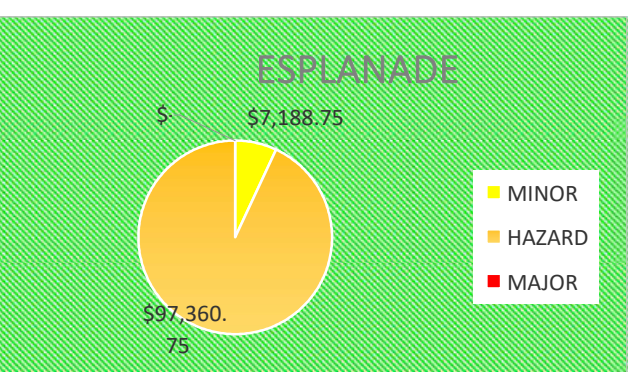
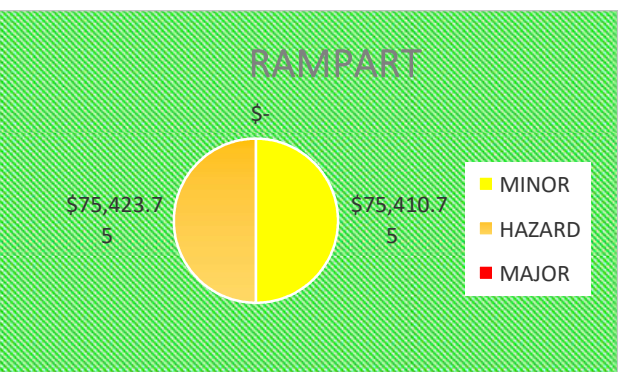
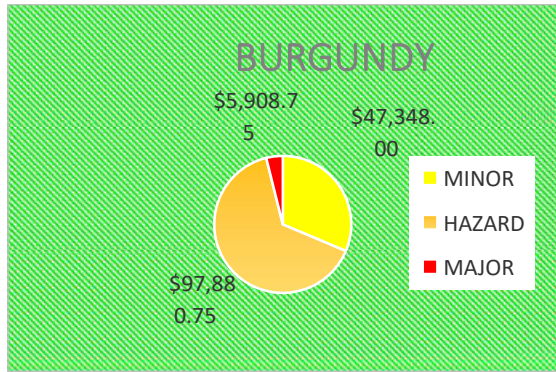
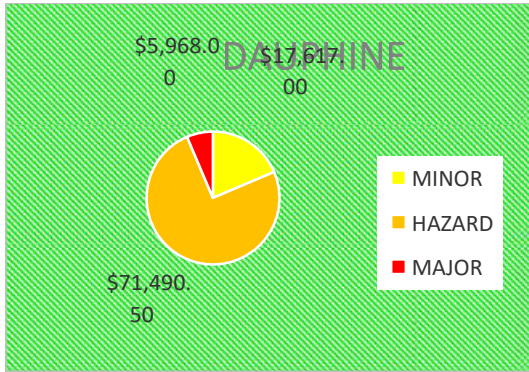
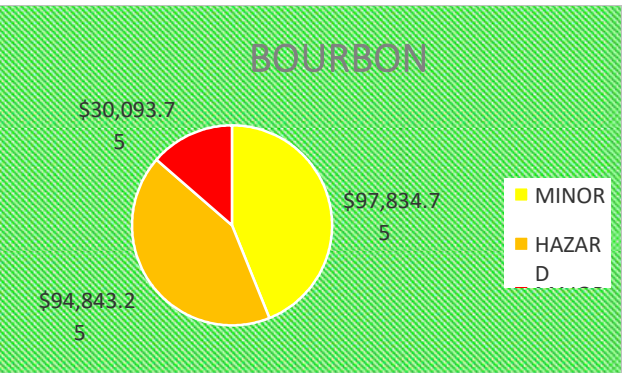
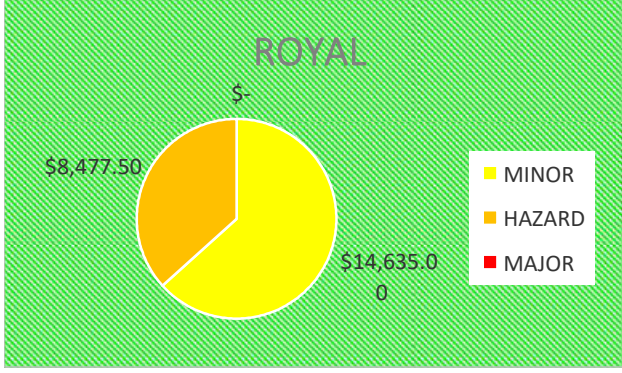
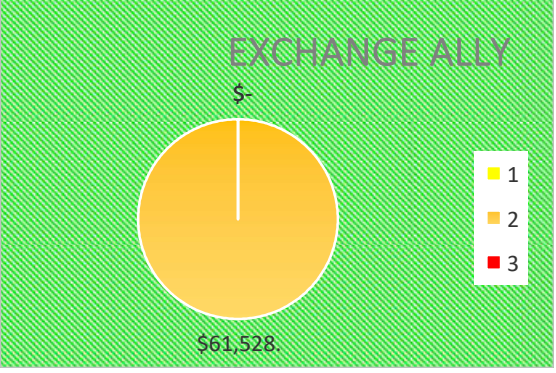
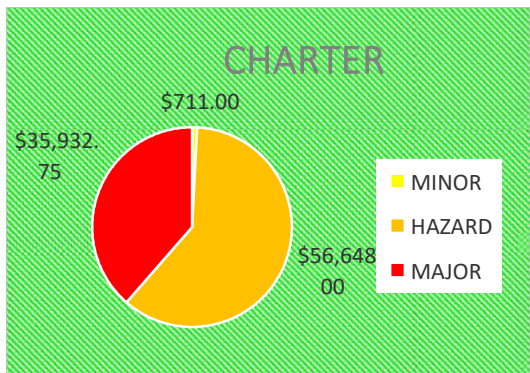
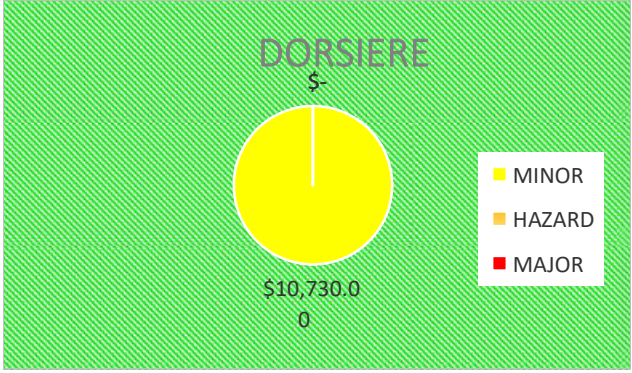
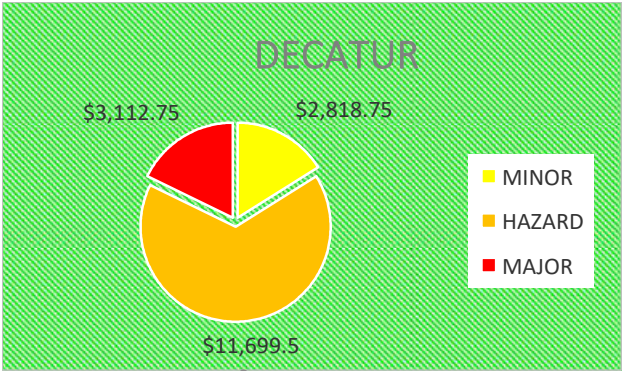
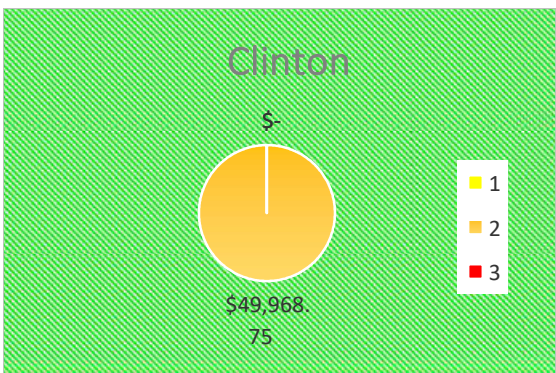
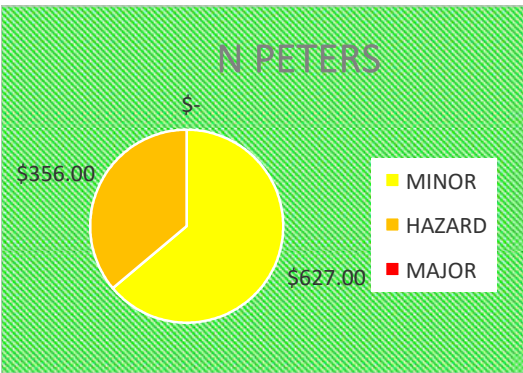
SWB
\$ 983.00
\$ -
\$ 12,485.25
\$ -
\$ 28,798.25
\$ -
\$ 11,559.00
\$ 68,103.25
\$ 11,485.00
\$ 40,480.75
\$ -
\$ -
\$ -
\$ 33,937.50
\$ 48,177.50
\$ 28,988.75
\$ 24,310.00
\$ -
\$ 1,144.25
\$ 3,414.00
\$ 4,227.25
\$ -
\$ 2,654.50
\$ 6,174.00
\$ 3,310.00
\$ 1,525.00
\$ 1,802.50
\$ 216.50
\$ 333,776.25
OTHER & OWNER
\$ 2,551,951.00

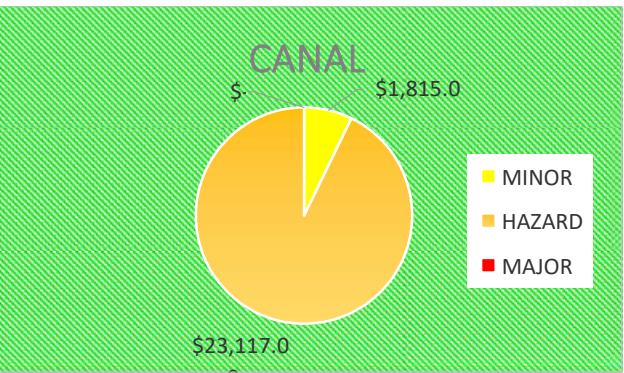
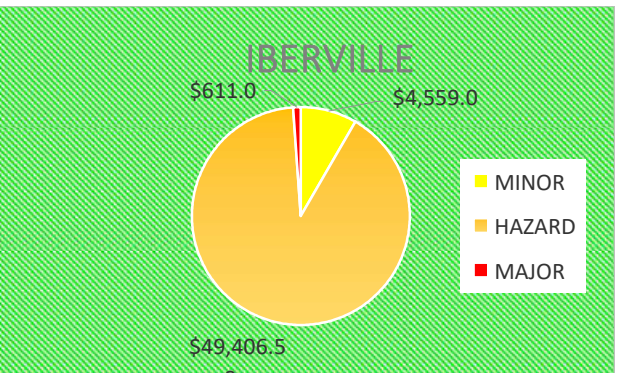
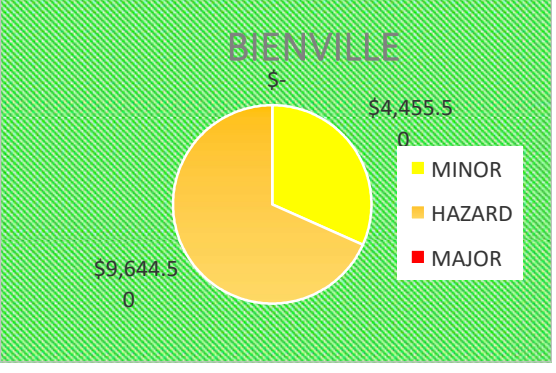
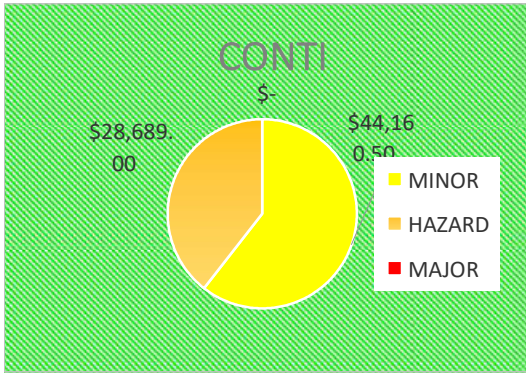
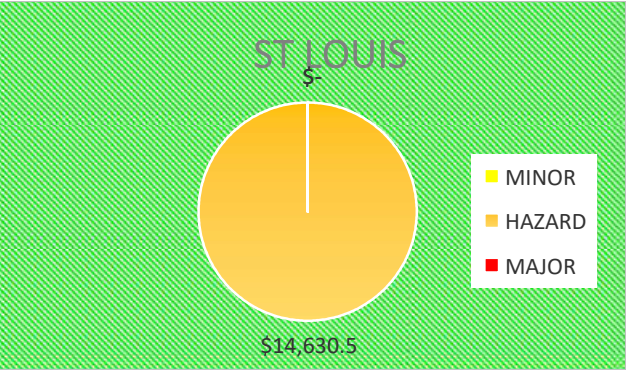
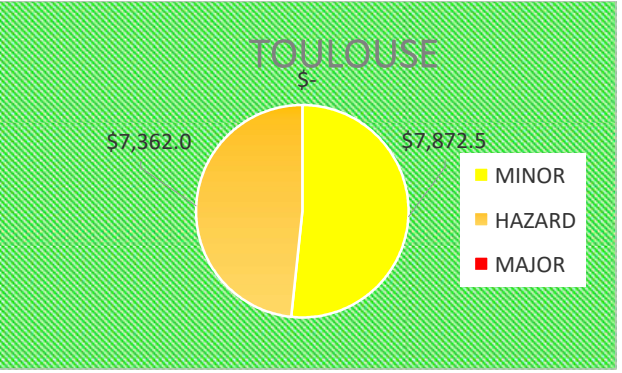
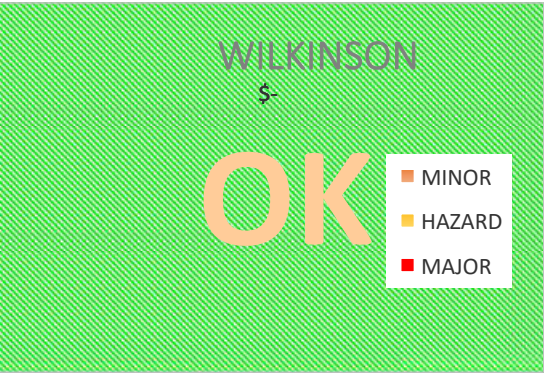
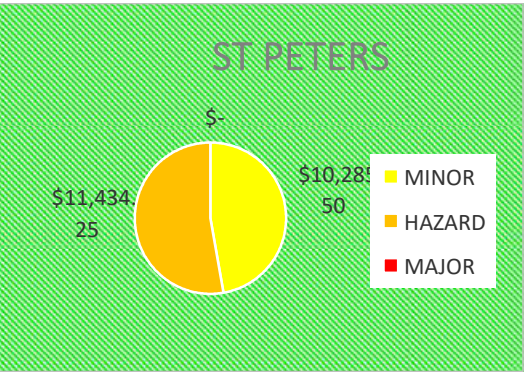
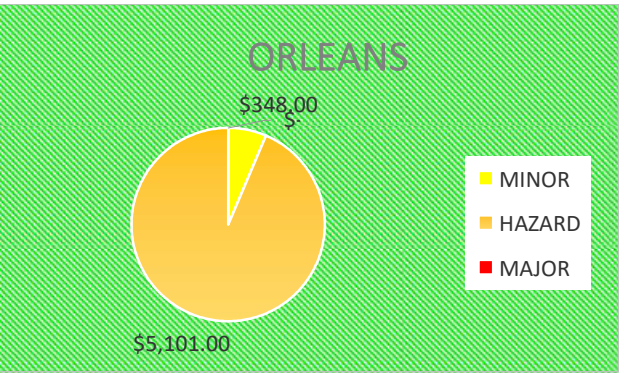
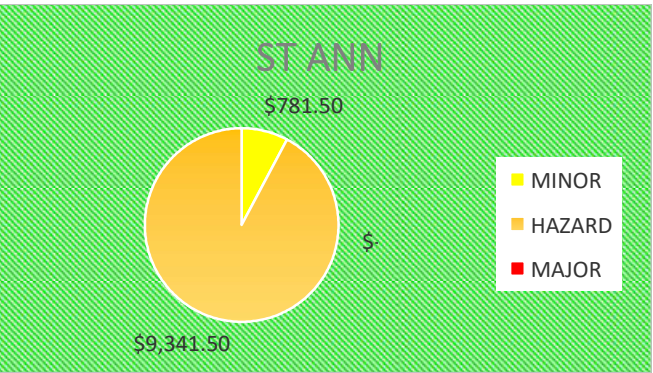
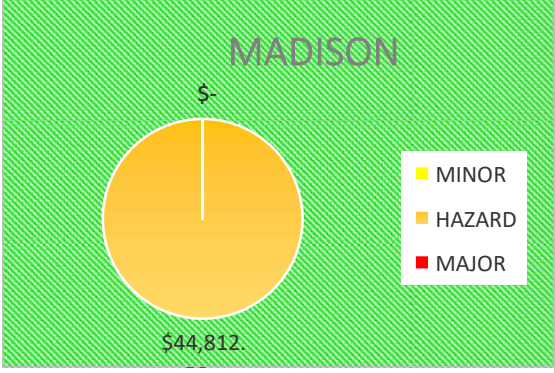
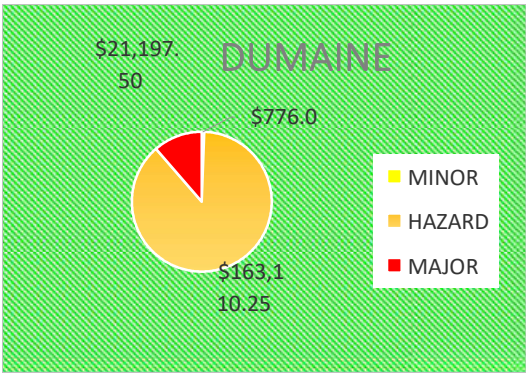
OWNER	8
SWB	142
OTHER	432
TTL	582

MAJOR HAZARD	39
HAZARD	336
MINOR HAZARD	207
TTL	582



FINAL SURVEY CONDUCTED AFTER WORK HAS STARTED ON BARRACKS AND GOV NICHOLS FINANCED WITH \$2 MIL. CITY BOND.





N PETERS STREET

OWNER	0	MAJOR HAZARD	0
SWB	2	HAZARD	1
OTHER	0	MINOR HAZARD	1
	2		2

Location	Material	Tripping Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
207 N Peters	Brick	Missing Brick repair.	 Hazard		4			\$ 356.00	\$ 186.00		0%			1		-	356.00	-
					2				\$ 170.00			\$						
217 N Peters Street	Brick	Non-Compliant Repair	 Minor Hazard		8			\$ 627.00	\$ 372.00		0%			1		627.00	-	-
					4				\$ 255.00			\$						
								\$ -	\$ -		0%					-	-	-
									\$ -			\$						
								\$ -	\$ -		0%					-	-	-
									\$ -			\$						

REPAIRS NEEDED	\$ 983.00	\$ -	\$ 983.00	\$ -	\$ 627.00	\$ 356.00	\$ -	\$ 983.00
REPAIRS COMPLETE	\$ -	\$ -	\$ -	\$ -				\$ -
REMAINDER		\$ -	\$ 983.00	\$ -				\$ 983.00

DECATUR STREET

OWNER	0	MAJOR HAZARD	5
SWB	13	HAZARD	13
OTHER	12	MINOR HAZARD	7
	25		25

Location	Material	Tripping Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
1241 Decatur	Brick	Replace Damaged Brick with New.			120	0	0	\$ 12,465.00	\$ 5,580.00		0%				1	-	12,465.00	-
					160	0	0		\$ 6,885.00			\$						
1222 Decatur Street	Brick	Missing Brick repair.			1	0	0	\$ 174.00	\$ 46.50		0%			1		174.00	-	-
					1	0	0		\$ 127.50			\$						
1227 Decatur Street	Brick	Replace missing Slate.					4	\$ 1,958.00	\$ 133.00		0%			1		-	1,958.00	-
							40		\$ 1,825.00			\$						
1218 Decatur Street	Brick	Missing Brick repair.			2			\$ 220.50	\$ 93.00		0%			1		-	220.50	-
					1				\$ 127.50			\$						
1213 Decatur Street	Brick	Missing Brick repair.			2			\$ 220.50	\$ 93.00		0%			1		220.50	-	-
					1				\$ 127.50			\$						
1209 Decatur Street	Brick	Missing Brick repair.			12			\$ 1,323.00	\$ 558.00		0%			1		1,323.00	-	-
					16				\$ 765.00			\$						
1205 Decatur Street	Brick	Missing Brick repair.			18			\$ 1,432.00	\$ 837.00		0%			1		-	1,432.00	-
					12				\$ 595.00			\$						
1204 Decatur Street	Brick	Missing Brick repair.			1			\$ 174.00	\$ 46.50		0%			1		174.00	-	-
					1				\$ 127.50			\$						
1200 Decatur Street	Brick	Missing Brick repair.			2			\$ 220.50	\$ 93.00		0%			1		-	220.50	-
					1				\$ 127.50			\$						

1130 Decatur Street	Brick	Missing Brick repair.	Minor Hazard	
1016 Decatur Street	Concrete	Joint Failure	Minor Hazard	
Artillary Park Decatur Street	Slate	Grout Failure	Hazard	
831 Decatur Street	Brick	Missing Brick repair	Hazard	
817 Decatur Street	Brick	Missing Brick repair.	Hazard	
807 Decatur Street	Slate	Cracked and Missing Slate	Hazard	
700 BLK Decatur @ St Ann Street	Slate	Repair and replace Slate	Major Hazard	
632 Decatur Street	Slate	Repair and replace Slate	Hazard	
540 Decatur Street	Slate	Missing Slate Tile	Hazard	
526 Decatur Street	Brick	Missing Brick	Minor Hazard	
524 Decatur Street	Brick	Missing Brick and Non-compliant repair	Hazard	

4

2

2

4

13

96

8

4

4

2

3

4

4

8

6

8

3

4

1

2

9

4

LABOR	MATERIAL	
\$	356.00	\$ 186.00
		\$ 170.00
\$	354.75	\$ 79.75
		\$ 275.00
\$	4,434.00	\$ 229.00
		\$ 4,205.00
\$	627.00	\$ 372.00
		\$ 255.00
\$	356.00	\$ 186.00
		\$ 170.00
\$	404.00	\$ 109.00
		\$ 295.00
\$	598.00	\$ 133.00
		\$ 465.00
\$	622.00	\$ 157.00
		\$ 465.00
\$	404.00	\$ 109.00
		\$ 295.00
\$	216.50	\$ 46.50
		\$ 170.00
\$	673.50	\$ 418.50
		\$ 255.00

0%

1

\$

0%

1

\$

0%

1

\$

0%

1

\$

0%

1

\$

0%

1

\$

0%

1

\$

0%

1

\$

0%

1

\$

0%

1

\$

0%

1

\$

356.00

-

-

354.75

-

-

-

4,434.00

-

-

627.00

-

-

356.00

-

-

404.00

-

-

-

598.00

-

622.00

-

-

404.00

-

216.50

-

-

-

673.50

-

508 Decatur Street	Brick	Missing Brick	 Hazard	
329 Decatur Street	Concrete	SW&B Damage at Access Cover	 Major Hazard	
311 Decatur Street	Brick	Missing Brick at Curb	 Major Hazard	
215 Decatur Street	Slate	Missing Brick at Curb	 Major Hazard	
100 Decatur Street	Brick	Missing and Damaged Brick at Joint and SW&B Access Cover	 Major Hazard	

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

2	LABOR	\$ 348.00	\$ 93.00
4	MATERIAL	\$ 255.00	
4	LABOR	\$ 540.75	\$ 95.75
8	MATERIAL	\$ 445.00	
12	LABOR	\$ 813.00	\$ 558.00
4	MATERIAL	\$ 255.00	
8	LABOR	\$ 627.00	\$ 372.00
4	MATERIAL	\$ 255.00	
6	LABOR	\$ 534.00	\$ 279.00
4	MATERIAL	\$ 255.00	

\$ 17,631.00
\$ -

0%	1	
\$		
0%	1	
\$		
0%	1	
\$		
0%	1	
\$		

\$ - \$ 12,485.25 \$ 5,145.75
\$ - \$ - \$ -
\$ - \$ 12,485.25 \$ 5,145.75

- 348.00 -
- - 540.75
- - 813.00
- - 627.00
- - 534.00

\$ 17,631.00
\$ -
\$ 17,631.00

DORSIERE ALLY

OWNER	1	MAJOR HAZARD	0
SWB	0	HAZARD	0
OTHER	0	MINOR HAZARD	1
	1		1

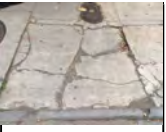
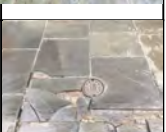
Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE		Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER		MINOR	HAZARD	MAJOR
Dosiere 100 BLOCK	CONCRETE	Not pedestrian friendly. Clean up walks and limit trash and equipment storage on walks.	MINOR HAZARD 						\$ 10,730.00	\$ _____				1				10,730.00	-	-
					250					\$ 10,730.00			us							

REPAIRS NEEDED	\$ 10,730.00	\$ 10,730.00	\$ -	\$ -	\$ 10,730.00	\$ -	\$ -	\$ 10,730.00
REPAIRS COMPLETE	\$ -	\$ -	\$ -	\$ -				\$ -
REMAINDER		\$ 10,730.00	\$ -	\$ -				\$ 10,730.00

CHARTER STREET

OWNER	0	MAJOR HAZARD	15
SWB	25	HAZARD	45
OTHER	37	MINOR HAZARD	2
	62		62

[illegible]

911 Charters Street	Concrete	Subsidence Cracks and voids in sidewalk		Major Hazard	
837 Charters Street	Concrete	S&WB Non - Compliant repair. Void trip hazard		Major Hazard	
631 Charters side of Tableau restaurant	Slate	Tile remove and reset with proper elevation and joints		Hazard	
625 Charters Street	Slate	Subsidence Cracks and voids in sidewalk		Major Hazard	
619 Charters Street	Slate	Tile remove and reset with proper elevation and joints		Hazard	
617 Charters entire 600 Block in need re-grouting	Slate	Tile remove and reset with proper elevation and joints		Hazard	
529 Charters Street	Slate	Tile remove and reset with proper elevation and joints		Hazard	
401 Charters entire 400 blk in need of re-grouting	Slate	Tile remove and reset with proper elevation and joints		Hazard	
327 Charters Street	Slate	Tile remove and reset with proper elevation and joints		Hazard	

40	MATERIAL	\$ 1,848.75	\$ 383.75
32	LABOR	\$ 1,465.00	
18	MATERIAL	\$ 822.75	\$ 207.75
12	LABOR	\$ 615.00	
2	MATERIAL	\$ 489.00	\$ 109.00
6	LABOR	\$ 380.00	
2	MATERIAL	\$ 404.00	\$ 109.00
4	LABOR	\$ 295.00	
2	MATERIAL	\$ 404.00	\$ 109.00
4	LABOR	\$ 295.00	
2	MATERIAL	\$ 489.00	\$ 109.00
6	LABOR	\$ 380.00	
3	MATERIAL	\$ 501.00	\$ 121.00
6	LABOR	\$ 380.00	
6	MATERIAL	\$ 792.00	\$ 157.00
12	LABOR	\$ 635.00	
3	MATERIAL	\$ 501.00	\$ 121.00
6	LABOR	\$ 380.00	

0%	1	-	-	1,848.75
0%	1	-	-	822.75
0%	1	-	489.00	-
0%	1	-	-	404.00
0%	1	-	404.00	-
0%	1	-	489.00	-
0%	1	-	501.00	-
0%	1	-	792.00	-
0%	1	-	501.00	-

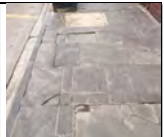
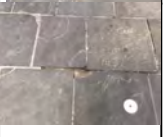
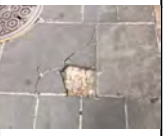
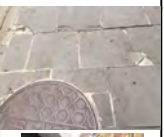
321 Charters Street	Slate	Tile remove and reset with proper elevation and joints	 Major Hazard	
309 Charters Street	Slate	Tile remove and reset with proper elevation and joints	 Hazard	
303 Charters Street	Slate	Tile remove and reset with proper elevation and joints	 Hazard	
300 Charters Street Block needs re-grouting	Slate	Tile remove and reset with proper elevation and joints	 Major Hazard	
231 Charters Street	Brick	Subsidence remove and replace sunken bricks with proper Joint restoration.	 Hazard	
233 Charters Street	Slate	Replace and grout tile	 Hazard	
221 Charters Street	Slate	Tile remove and reset with proper elevation and joints	 Hazard	
207 Charters Street	Slate	Replace and Grout Missing Tile	 Hazard	
200 Block Charters Street	Slate	Replace missing tiles and re-grout joints entire street	 Major Hazard	

8

8

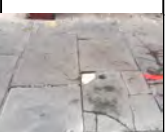
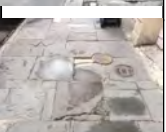
2	MATERIAL	\$ 404.00	\$ 109.00
4	LABOR		\$ 295.00
2	MATERIAL	\$ 404.00	\$ 109.00
4	LABOR		\$ 295.00
2	MATERIAL	\$ 404.00	\$ 109.00
4	LABOR		\$ 295.00
20	MATERIAL	\$ 5,550.00	\$ 325.00
120	LABOR		\$ 5,225.00
8	MATERIAL	\$ 797.00	\$ 372.00
8	LABOR		\$ 425.00
1	MATERIAL	\$ 307.00	\$ 97.00
2	LABOR		\$ 210.00
5	MATERIAL	\$ 780.00	\$ 145.00
12	LABOR		\$ 635.00
2	MATERIAL	\$ 404.00	\$ 109.00
4	LABOR		\$ 295.00
12	MATERIAL	\$ 5,454.00	\$ 229.00
120	LABOR		\$ 5,225.00

0%	1	-	-	404.00
0%	1	-	404.00	-
0%	1	-	404.00	-
0%	1	-	-	5,550.00
0%	1	-	797.00	-
0%	1	-	307.00	-
0%	1	-	780.00	-
0%	1	-	404.00	-
0%	1	-	-	5,454.00

139 Charters Street	Slate	Tile remove and reset with proper elevation and joints		
121 Charters Street	Slate	Re-grout Joints		
105 Charters Street	Slate	Re-grout joints		
105 Charters Street	Slate			
100 Charters Street	Slate	Replace Damaged Curb Stone. Re-grout Joints		
120 Charters Street	Slate	Replace damaged tiles re-grout joints		
128 Charters Street	Slate	Replace damaged tiles re-grout joints		
100 Block Charters Street	Slate	Re-grout joints for entire block		
200 Charters	Slate	Remove and replace broken tiles re-grout joints		

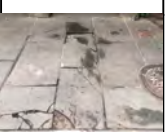
10	MATERIAL	\$ 3,730.00	\$ 205.00
80	LABOR		\$ 3,525.00
2	MATERIAL	\$ 404.00	\$ 109.00
4	LABOR		\$ 295.00
1	MATERIAL	\$ 307.00	\$ 97.00
2	LABOR		\$ 210.00
6	MATERIAL	\$ 3,682.00	\$ 157.00
80	LABOR		\$ 3,525.00
2	MATERIAL	\$ 404.00	\$ 109.00
4	LABOR		\$ 295.00
1	MATERIAL	\$ 392.00	\$ 97.00
4	LABOR		\$ 295.00
6	MATERIAL	\$ 1,302.00	\$ 157.00
24	LABOR		\$ 1,145.00
6	MATERIAL	\$ 7,932.00	\$ 157.00
180	LABOR		\$ 7,775.00
5	MATERIAL	\$ 1,970.00	\$ 145.00
40	LABOR		\$ 1,825.00

0%	1	-	3,730.00	-
0%	1	-	404.00	-
0%	1	-	307.00	-
0%	1	-	3,682.00	-
0%	1	-	404.00	-
0%	1	-	392.00	-
0%	1	-	1,302.00	-
0%	1	-	7,932.00	-
0%	1	-	1,970.00	-

214 Charters Street	Slate	Re-grout joints.	 Hazard	
216 Charters Street	Slate	Replace missing Tile re-grout joints	 Hazard	
216B Charters Street	Slate	Replace Broken and missing tiles re-grout joints	 Hazard	
230 Charters Street	Slate	Replace Broken and missing tiles re-grout joints	 Hazard	
234 Charters	Slate	Non-compliant repair, Replace Broken and missing tiles re-grout joints.	 Hazard	
234 Charters			 hazard	
200 Block Charters Street	Slate	Re-grout entire block. Replace broken and missing tiles.	 Major Hazard	
236 Charters Street	Slate	Replace Broken Tile, re-grout joints, install missing Light Pole.	 Major Hazard	
308 Charters Street	Slate	Non-compliant repair, Replace Broken and missing tiles re-grout joints.	 Major Hazard	

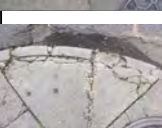
6	MATERIAL	\$ 1,982.00	\$ 157.00
40	LABOR		\$ 1,825.00
1	MATERIAL	\$ 392.00	\$ 97.00
4	LABOR		\$ 295.00
6	MATERIAL	\$ 962.00	\$ 157.00
16	LABOR		\$ 805.00
8	MATERIAL	\$ 986.00	\$ 181.00
16	LABOR		\$ 805.00
12	MATERIAL	\$ 2,054.00	\$ 229.00
40	LABOR		\$ 1,825.00
2	MATERIAL	\$ 489.00	\$ 109.00
6	LABOR		\$ 380.00
16	MATERIAL	\$ 7,202.00	\$ 277.00
160	LABOR		\$ 6,925.00
12	MATERIAL	\$ 1,374.00	\$ 229.00
24	LABOR		\$ 1,145.00
8	MATERIAL	\$ 1,326.00	\$ 181.00
24	LABOR		\$ 1,145.00

0%	1	-	1,982.00	-
0%	1	-	392.00	-
0%	1	-	962.00	-
0%	1	-	986.00	-
0%	1	-	2,054.00	-
0%	1	-	489.00	-
0%	1	-	-	7,202.00
0%	1	-	-	1,374.00
0%	1	-	-	1,326.00

Corner 340 Charters	Slate	Replace Broken and missing tiles re-grout joints.	Major Hazard	
410 Charters	Slate	Replace Broken and missing tiles re-grout joints.	Hazard	
430 Charters	Slate	Replace Broken and missing tiles re-grout joints.	Major Hazard	
Corner 440 Charters Street	Slate	Replace Broken Tile, re-grout Joints	Hazard	
500 Charters Street	Slate	Replace Broken Tile, re-grout Joints	Hazard	
508 Charters Street	Slate	Replace Broken Tile, re-grout Joints	Hazard	
530 Charters Street	Slate	Replace Broken and missing tiles re-grout joints	Hazard	
630 Charters Street	Slate	Replace Broken tile re-grout joints	Hazard	
628-600 Charters parking area rec concrete	Slate	Replace Broken and missing tiles re-grout joints	Major Hazard	

4	MATERIAL	\$ 428.00	\$ 133.00
4	LABOR		\$ 295.00
4	MATERIAL	\$ 428.00	\$ 133.00
4	LABOR		\$ 295.00
12	MATERIAL	\$ 1,374.00	\$ 229.00
24	LABOR		\$ 1,145.00
4	MATERIAL	\$ 598.00	\$ 133.00
8	LABOR		\$ 465.00
10	MATERIAL	\$ 1,010.00	\$ 205.00
16	LABOR		\$ 805.00
6	MATERIAL	\$ 962.00	\$ 157.00
16	LABOR		\$ 805.00
8	MATERIAL	\$ 816.00	\$ 181.00
12	LABOR		\$ 635.00
6	MATERIAL	\$ 962.00	\$ 157.00
16	LABOR		\$ 805.00
20	MATERIAL	\$ 5,550.00	\$ 325.00
120	LABOR		\$ 5,225.00

0%	1	-	-	428.00
0%	1	-	428.00	-
0%	1	-	-	1,374.00
0%	1	-	598.00	-
0%	1	-	1,010.00	-
0%	1	-	962.00	-
0%	1	-	816.00	-
0%	1	-	962.00	-
0%	1	-	-	5,550.00

630 Charters Street	Slate	Non-compliant repair. Remove and replace with fitted tiles.		
800 Charters Street	Slate	Replace missing tile, re-grout joints.		
822 Charters Street	Concrete	Subsidence repair, replace concrete and Street Name.		
900 Charters	Concrete	Repair and replace failed concrete.		
940 Charters Street Corner	Concrete	Repair curb and replace failed concrete walk.		
1014 Charters Street	Concrete	Replace gravel filler with concrete		
1112 Charters Street	Concrete	Replace fractured concrete 7X8 with new.		
1112 Charters Street	Concrete	Replace fractured concrete with new.		
1112 Charters Street	Concrete	Replace fractured concrete with new.		

4	MATERIAL	\$ 1,278.00	\$ 133.00
24	LABOR		\$ 1,145.00
2	MATERIAL	\$ 574.00	\$ 109.00
8	LABOR		\$ 465.00
16	MATERIAL	\$ 1,996.75	\$ 191.75
40	LABOR		\$ 1,805.00
40	MATERIAL	\$ 3,888.75	\$ 383.75
80	LABOR		\$ 3,505.00
16	MATERIAL	\$ 2,336.75	\$ 191.75
48	LABOR		\$ 2,145.00
16	MATERIAL	\$ 1,656.75	\$ 191.75
32	LABOR		\$ 1,465.00
56	MATERIAL	\$ 1,636.75	\$ 511.75
24	LABOR		\$ 1,125.00
8	MATERIAL	\$ 742.75	\$ 127.75
12	LABOR		\$ 615.00
12	MATERIAL	\$ 1,114.75	\$ 159.75
20	LABOR		\$ 955.00

0%	1	-	1,278.00	-
0%	1	-	574.00	-
0%	1	-	1,996.75	-
0%	1	-	3,888.75	-
0%	1	-	2,336.75	-
0%	1	-	1,656.75	-
0%	1	-	1,636.75	-
0%	1	-	742.75	-
0%	1	-	1,114.75	-

--	--	--	--	--

REPAIRS NEEDED

REPAIRS COMPLETE

REMAINDER

\$

93,291.75

\$

-

0%

\$

\$

-

\$

28,798.25

\$

64,493.50

\$

-

\$

-

\$

-

\$

-

\$

28,798.25

\$

64,493.50

\$

711.00

\$

56,648.00

\$

35,932.75

\$

93,291.75

\$

-

\$

93,291.75

EXCHANGE ALLY

OWNER	1	MAJOR HAZARD	0
SWB	0	HAZARD	1
OTHER	0	MINOR HAZARD	0
	1		1

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
EXCHANGE 100 BLOCK	CONCRETE	Rebuild concrete sidewalks 2 ea at 7' x 305'	 Hazard		4270			\$ 61,528.75	\$ 34,223.75				1				61,528.75	
					640				\$ 27,305.00			\$						
								\$ -	\$ -									
									\$ -			\$						
								\$ -	\$ -									
								\$ -	\$ -									
								\$ -	\$ -									
								\$ -	\$ -									
								\$ -	\$ -									

REPAIRS NEEDED	\$	61,528.75	\$	61,528.75	\$	-	\$	-	\$	-	\$	-	\$	-	\$	-	\$	61,528.75	\$	-	\$	61,528.75
REPAIRS COMPLETE	\$	-		\$	-		\$	-	\$	-	\$	-	\$	-	\$	-	\$	-	\$	-	\$	-
REMAINDER								\$	61,528.75			\$	61,528.75		\$	-	\$	61,528.75			\$	61,528.75

ROYAL STREET

OWNER	0	MAJOR HAZARD	0
SWB	8	HAZARD	8
OTHER	9	MINOR HAZARD	9
	17		17

Location	Material	Tripping Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER		MINOR	HAZARD	MAJOR
100 – 140 Royal Street	Slate	Grout Joint Repair and Replace	Minor Hazard					4	\$ 768.00	\$ 133.00		0%		1			768.00	-	-
								12		\$ 635.00		\$							
200 – 240 Royal Street	Slate	Grout Joint Repair and Replace	Minor Hazard					4	\$ 768.00	\$ 133.00		0%		1			768.00	-	-
								12		\$ 635.00		\$							
310 Royal Street	Slate	Worn Non Compliant Brick and Damaged Tile Repair Replace Broke Tile Grout Joints	HAZARD					8	\$ 1,156.00	\$ 181.00		0%			1		-	1,156.00	-
								20		\$ 975.00		\$							
300 – 340 Royal Street	Slate	Repair and Replace Tiles and Grout Joints length of Street	Minor Hazard					6	\$ 1,132.00	\$ 157.00		0%			1		1,132.00	-	-
								20		\$ 975.00		\$							
400 – 440 Royal Street	Slate	Repair and Replace Tiles and Grout Joints length of Street	Minor Hazard					5	\$ 2,820.00	\$ 145.00		0%			1		2,820.00	-	-
								60		\$ 2,675.00		\$							
500 – 540 Royal Street	Slate	Repair and Replace Tiles and Grout Joints length of Street	Minor Hazard					4	\$ 2,808.00	\$ 133.00		0%			1		2,808.00	-	-
								60		\$ 2,675.00		\$							

600 – 640 Royal Street	Slate	Repair and Replace Tiles and Grout Joints length of Street	Minor Hazard	
640 Royal Street	Slate	Replace Broken and Loose Tiles Grout Joints	Hazard	
700 – 720 Royal Street	Slate	Repair Grout Joints and Replace Broken Tiles	Minor Hazard	
700 Block Royal Street	Slate	Repair replace Broken Tiles and Grout Joints	Minor Hazard	
730 Royal Street, Entry to Pirates Alley Pedestrian Walk .	Slate	Repair Replace Tiles and Repair Grout Joints length of Pirates Alley. Install Ballards to prevent vehicle Traffic.	Hazard	
742 Royal Street	Slate	Replace Broken Tiles and Repair and Replace Grout Joints.	Hazard	
812 Royal Street	Slate	Remove Non-Compliant Material replace with Slate and repair and replace grout Joints.	Hazard	
920 Royal Street	Concrete	S&WB non Compliant repair. Remove and replace with Proper concrete Walk.	Hazard	
1032 Royal Street	Concrete	S&WB non-Compliant repair. Remove and replace with Proper concrete Walk.	Hazard	

4	MATERIAL	\$ 1,958.00	\$ 133.00
40	LABOR	\$ 1,825.00	
2	MATERIAL	\$ 744.00	\$ 109.00
12	LABOR	\$ 635.00	
2	MATERIAL	\$ 1,934.00	\$ 109.00
40	LABOR	\$ 1,825.00	
4	MATERIAL	\$ 1,958.00	\$ 133.00
40	LABOR	\$ 1,825.00	
12	MATERIAL	\$ 2,054.00	\$ 229.00
40	LABOR	\$ 1,825.00	
2	MATERIAL	\$ 744.00	\$ 109.00
12	LABOR	\$ 635.00	
2	MATERIAL	\$ 744.00	\$ 109.00
12	LABOR	\$ 635.00	
4	MATERIAL	\$ 540.75	\$ 95.75
8	LABOR	\$ 445.00	
2	MATERIAL	\$ 524.75	\$ 79.75
8	LABOR	\$ 445.00	

0%	1	1,958.00	-	-
0%	1	-	744.00	-
0%	1	1,934.00	-	-
0%	1	1,958.00	-	-
0%	1	-	2,054.00	-
0%	1	-	744.00	-
0%	1	-	744.00	-
0%	1	-	540.75	-
0%	1	-	524.75	-

1118 Royal Street	Slate	Replace Broken Tiles remove and replace grout joints.	 Minor Hazard	
1212 Royal Street	Slate	Replace Broken Tiles remove and replace grout joints.	 Hazard	

1	MATERIAL	\$ 489.00	\$ 109.00
6	LABOR		\$ 380.00
15	MATERIAL	\$ 1,970.00	\$ 145.00
40	LABOR		\$ 1,825.00
	MATERIAL	\$ -	\$ -
	LABOR		\$ -
	MATERIAL	\$ -	\$ -
	LABOR		\$ -
	MATERIAL	\$ -	\$ -
	LABOR		\$ -
	MATERIAL	\$ -	\$ -
	LABOR		\$ -
	MATERIAL	\$ -	\$ -
	LABOR		\$ -
	MATERIAL	\$ -	\$ -
	LABOR		\$ -

0%	1	489.00	-	-
		\$		
0%	1	-	1,970.00	-
		\$		
0%		-	-	-
		\$		
0%		-	-	-
		\$		
0%		-	-	-
		\$		
0%		-	-	-
		\$		
0%		-	-	-
		\$		

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

\$ 23,112.50	\$ -	\$ 11,559.00	\$ 11,553.50	\$ 14,635.00	\$ 8,477.50	\$ -	\$ 23,112.50
\$ -	\$ -	\$ -	\$ -				\$ -
	\$ -	\$ 11,559.00	\$ 11,553.50				\$ 23,112.50

BOURBON STREET

OWNER	0	MAJOR HAZARD	4
SWB	42	HAZARD	23
OTHER	66	MINOR HAZARD	81
	108		108

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE		Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER		MINOR	HAZARD	MAJOR
315 Bourbon Street	Brick	Grout Repair Maintenance			1		0		\$ 174.00	\$ 46.50		0%			1			174.00	-	-
					1		0			\$ 127.50			\$							
315 Bourbon Street	Brick	Replace Cox Utility Access Box cover.			6				\$ 449.00	\$ 279.00					1			449.00	-	-
					2					\$ 170.00			\$							
327 Bourbon Street	Brick	Replace Missing Brick			1				\$ 174.00	\$ 46.50						1		174.00	-	-
					1					\$ 127.50			\$							
325 - 327 Bourbon Street	Brick	Joint Repair			4				\$ 526.00	\$ 186.00						1		526.00	-	-
					6					\$ 340.00			\$							
339 Bourbon Street	Brick	Joint Repair			4				\$ 526.00	\$ 186.00						1		526.00	-	-
					6					\$ 340.00			\$							
401 Bourbon Street	Brick	Joint Repair			2				\$ 348.00	\$ 93.00					1			348.00	-	-
					4					\$ 255.00			\$							
409 Bourbon Street	Brick	Joint Repair			1				\$ 46.50	\$ 46.50					1			46.50	-	-
										\$ -			\$							
411 Bourbon Street	Brick	Sand and Level Brick Pavers			1				\$ 301.50	\$ 46.50						1		301.50	-	-
					4					\$ 255.00			\$							
412 Bourbon Street	Brick	Repair Joints at Electric Access Box			1				\$ 216.50	\$ 46.50					1			216.50	-	-
					2					\$ 170.00			\$							
423 Bourbon Street	Brick	Repair Joints at Electric Access Box			1				\$ 216.50	\$ 46.50					1			216.50	-	-
					2					\$ 170.00			\$							

400 Bourbon at St. Louis	Brick	Repair Street Name Tiles.	Minor Hazard	
435 Bourbon Street	Brick	Replace Brick and reposition sand and grout.	Minor Hazard	
441 Bourbon Street	Brick	Joint Repair, relevel brick	Minor Hazard	
441 Bourbon Street	Brick	Joint Repair, relevel brick	Minor Hazard	
539 Bourbon Street	Brick	Repair Joints at Electric Access Box	Minor Hazard	
909 Bourbon Street	Concrete	Replace Concrete at abandon Trash port.	Minor Hazard	
915 Bourbon Street	Concrete	Replace Concrete walk level and true.	Minor Hazard	
919 Bourbon Street	Concrete	Replace Concrete walk level and true.	Hazard	
921 Bourbon Street	Concrete	Replace Concrete walk level and true.	Hazard	
923 Bourbon Street	Concrete	Reset Subsided Curb and Replace Concrete walk level and true.	Hazard	
923 Bourbon Street	Concrete	Remove and replace Side Walk to furterest extent needed to solve Subsidence. .	Major Hazard	

1

1

2

2

3

4

1

1

1

2

4

6

4

6

49

24

16

16

24

32

120

120


	LABOR	MATERIAL
	\$ 174.00	\$ 46.50
	\$ 127.50	
	LABOR	MATERIAL
	\$ 263.00	\$ 93.00
	\$ 170.00	
	LABOR	MATERIAL
	\$ 394.50	\$ 139.50
	\$ 255.00	
	LABOR	MATERIAL
	\$ 174.00	\$ 46.50
	\$ 127.50	
	LABOR	MATERIAL
	\$ 216.50	\$ 46.50
	\$ 170.00	
	LABOR	MATERIAL
	\$ 455.75	\$ 95.75
	\$ 360.00	
	LABOR	MATERIAL
	\$ 455.75	\$ 95.75
	\$ 360.00	
	LABOR	MATERIAL
	\$ 1,580.75	\$ 455.75
	\$ 1,125.00	
	LABOR	MATERIAL
	\$ 976.75	\$ 191.75
	\$ 785.00	
	LABOR	MATERIAL
	\$ 1,720.75	\$ 255.75
	\$ 1,465.00	
	LABOR	MATERIAL
	\$ 6,228.75	\$ 1,023.75
	\$ 5,205.00	

		1	174.00	-	-
		1	263.00	-	-
		1	394.50	-	-
		1	174.00	-	-
		1	216.50	-	-
		1	455.75	-	-
		1	455.75	-	-
		1	-	1,580.75	-
		1	-	976.75	-
		1	-	1,720.75	-
		1	-	-	6,228.75

927 Bourbon Street	Concrete	Remove and replace side walk to standard.	Minor Hazard	
927 Bourbon Street	Concrete	Replace Concrete at abandon Trash port.	Minor Hazard	
929 Bourbon Street	Concrete	Remove and replace side walk to standard.	Minor Hazard	
931 Bourbon Street	Concrete	Reset Curb to elevation replace damaged walk level and true..	Hazard	
933 Bourbon Street 2 & 3	Concrete	Replace Concrete at abandon Trash port.	Hazard	
933 Bourbon Street 1	Concrete	Remove and replace side walk to standard.	Hazard	
933 Bourbon Street	Concrete	Remove and replace side walk to standard.	Hazard	
941 Bourbon Street	Concrete	Reset Subsided Curb Remove and replace side walk to standard.	Hazard	
1003 Bourbon Street	Concrete	Remove and replace side walk to standard.	Hazard	

25	LABOR	\$ 1,728.75	\$ 263.75
32	MATERIAL		\$ 1,465.00
8	LABOR	\$ 912.75	\$ 127.75
16	MATERIAL		\$ 785.00
24	LABOR	\$ 1,210.75	\$ 255.75
20	MATERIAL		\$ 955.00
32	LABOR	\$ 2,974.75	\$ 319.75
60	MATERIAL		\$ 2,655.00
20	LABOR	\$ 1,178.75	\$ 223.75
20	MATERIAL		\$ 955.00
25	LABOR	\$ 2,068.75	\$ 263.75
40	MATERIAL		\$ 1,805.00
60	LABOR	\$ 5,748.75	\$ 543.75
120	MATERIAL		\$ 5,205.00
270	LABOR	\$ 7,428.75	\$ 2,223.75
120	MATERIAL		\$ 5,205.00
270	LABOR	\$ 7,428.75	\$ 2,223.75
120	MATERIAL		\$ 5,205.00

		1	1,728.75	-	-
\$					
		1	912.75	-	-
\$					
		1	1,210.75	-	-
\$					
		1	-	2,974.75	-
\$					
		1	-	1,178.75	-
\$					
		1	-	2,068.75	-
\$					
		1	-	5,748.75	-
\$					
		1	-	7,428.75	-
\$					
		1	-	7,428.75	-
\$					

1011 Bourbon Street	Concrete	Subsidence at Utilities. Repair and replace	Minor Hazard	
1017 Bourbon Street	Concrete	Non Compliant Repair remove replace.	Minor Hazard	
1029 Bourbon Street	Concrete	non Compliant Repair remove replace.	Minor Hazard	
1035 Bourbon Street	Concrete	non Compliant Repair remove replace.	Minor Hazard	
1101 Bourbon Street	Concrete	Failed Concrete Sidewalk, remove replace	Minor Hazard	
1117 Bourbon Street	Concrete	Non Compliant Repair remove replace.	Minor Hazard	
1125 Bourbon Street	Concrete	Non Compliant Repair remove replace.	Minor Hazard	
1129 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace	Minor Hazard	
1131 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace	Minor Hazard	
1137 Bourbon Street	Concrete	Non Compliant Repair remove replace.	Minor Hazard	
1139 Bourbon Street	Concrete	Non Compliant Repair remove replace.	Minor Hazard	
1203 Bourbon Street	Concrete	Non Compliant Repair remove replace.	Minor Hazard	
1211 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace	Minor Hazard	
1217 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace	Minor Hazard	
1223 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace	Hazard	


4	\$ 710.75	\$ 95.75
12		\$ 615.00
8	\$ 912.75	\$ 127.75
16		\$ 785.00
12	\$ 1,284.75	\$ 159.75
24		\$ 1,125.00
16	\$ 1,656.75	\$ 191.75
32		\$ 1,465.00
12	\$ 1,284.75	\$ 159.75
24		\$ 1,125.00
16	\$ 1,656.75	\$ 191.75
32		\$ 1,465.00
12	\$ 1,284.75	\$ 159.75
24		\$ 1,125.00
40	\$ 2,528.75	\$ 383.75
48		\$ 2,145.00
36	\$ 2,156.75	\$ 351.75
40		\$ 1,805.00
24	\$ 1,890.75	\$ 255.75
36		\$ 1,635.00
24	\$ 1,890.75	\$ 255.75
36		\$ 1,635.00
24	\$ 2,060.75	\$ 255.75
40		\$ 1,805.00
48	\$ 3,272.75	\$ 447.75
64		\$ 2,825.00
32	\$ 2,974.75	\$ 319.75
60		\$ 2,655.00
40	\$ 3,888.75	\$ 383.75
80		\$ 3,505.00

		1	710.75	-	-
\$					
		1	912.75	-	-
\$					
		1	1,284.75	-	-
\$					
		1	1,656.75	-	-
\$					
		1	1,284.75	-	-
\$					
		1	1,656.75	-	-
\$					
		1	1,284.75	-	-
\$					
		1	2,528.75	-	-
\$					
		1	2,156.75	-	-
\$					
		1	1,890.75	-	-
\$					
		1	1,890.75	-	-
\$					
		1	2,060.75	-	-
\$					
		1	3,272.75	-	-
\$					
		1	2,974.75	-	-
\$					
		1	-	3,888.75	-
\$					

1225 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace		
1231 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace		
1241 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace		
1243 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace		
1307 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace		
1309 Bourbon Street	Concrete	Subsidence at granite curb and sidewalk. Remove repair and replace		
1311 Bourbon Street	Concrete	Replace Ballard with new and repair concrete		
235 Bourbon Street	Brick	Repair Joints at Electric Access Box		
217 Bourbon Street	Brick	Repair Joints at Electric Access Box		
201 Bourbon Street	Brick	Replace Brick and Joints at Manhole cover.		
115 Bourbon Street	Brick	Repair Joints at Electric Access Box		
101 Bourbon Street	Slate Tile	Repair and jill joints.		
100 Bourbon Street	Slate Tile	Remove Replace Curb Stones reset at proper elevation.		
110 Bourbon Street	Brick	Repair Joints at Electric Access Box		
116 Bourbon Street	Brick	Repair Joints at Electric Access Box		
144 Bourbon Street	Brick	Replace Bric and Iberville Steet Name.		

40	LABOR	\$ 3,888.75	\$ 383.75
80	MATERIAL	\$ 3,505.00	
40	LABOR	\$ 3,038.75	\$ 383.75
60	MATERIAL	\$ 2,655.00	
32	LABOR	\$ 2,124.75	\$ 319.75
40	MATERIAL	\$ 1,805.00	
48	LABOR	\$ 3,952.75	\$ 447.75
80	MATERIAL	\$ 3,505.00	
60	LABOR	\$ 5,748.75	\$ 543.75
120	MATERIAL	\$ 5,205.00	
60	LABOR	\$ 5,748.75	\$ 543.75
120	MATERIAL	\$ 5,205.00	
12	LABOR	\$ 1,964.75	\$ 159.75
40	MATERIAL	\$ 1,805.00	
1	LABOR	\$ 216.50	\$ 46.50
2	MATERIAL	\$ 170.00	
1	LABOR	\$ 216.50	\$ 46.50
2	MATERIAL	\$ 170.00	
1	LABOR	\$ 216.50	\$ 46.50
2	MATERIAL	\$ 170.00	
1	LABOR	\$ 216.50	\$ 46.50
2	MATERIAL	\$ 170.00	
1	LABOR	\$ 477.00	\$ 97.00
5	MATERIAL	\$ 380.00	
11	LABOR	\$ 780.00	\$ 145.00
12	MATERIAL	\$ 635.00	
1	LABOR	\$ 216.50	\$ 46.50
2	MATERIAL	\$ 170.00	
1	LABOR	\$ 216.50	\$ 46.50
2	MATERIAL	\$ 170.00	
1	LABOR	\$ 547.50	\$ 167.50
2	MATERIAL	\$ 380.00	

		1		3,888.75	
\$					
		1	3,038.75		
\$					
		1	2,124.75		
\$					
		1		3,952.75	
\$					
		1		5,748.75	
\$					
		1		5,748.75	
\$					
		1	1,964.75		
\$					
		1		216.50	
\$					
		1		216.50	
\$					
		1		216.50	
\$					
		1		477.00	
\$					
		1		780.00	
\$					
		1		216.50	
\$					
		1		216.50	
\$					
		1		547.50	
\$					

206 Bourbon Street	Brick	Repair Joints at Electric Access Box	Minor Hazard	
208 Bourbon Street	Brick	Repair Joints at curb stone.	Minor Hazard	
222 Bourbon Street	Brick	Repair Joints at Electric Access Box	Minor Hazard	
224 Bourbon Street	Brick	Repair Joints at Electric Access Box	Minor Hazard	
238 Bourbon Street	Brick	Repair Joints at curb stone.	Minor Hazard	
Bourbon and Bienville-old Absinthe House	Slate Tile	Non conforming repair. Remove replace Tile	Minor Hazard	
Bourbon Street Royal Sonesta - daiquiri shop	Brick	Replace Brick and Repair Joints at curb stone.	Minor Hazard	
Bourbon Street Royal Sonesta- Regal Suite	Brick	Replace Brick and Repair Joints at curb stone.	Minor Hazard	
Royal Sonesta-Bourbon at Conti	Brick	Remove and replace Granite Curb subsidence.	Minor Hazard	
400 Bourbon	Brick	Re set Brick and replace joint materials.	Minor Hazard	
410 Bourbon	Brick	Re set Brick and replace joint materials.	Minor Hazard	
416 - 418 Bourbon	Brick	Re set Brick and replace joint materials.	Minor Hazard	
420 Bourbon	Brick	Re set Brick and replace joint materials.	Minor Hazard	
424 Bourbon	Brick	Repair Joints at curb stone.	Minor Hazard	
516 Bourbon Street	Brick	Repair Joints at Electric Access Box	Minor Hazard	
522 Bourbon Street	Brick	Repair Joints at curb stone.	Minor Hazard	

1	LABOR	\$ 216.50	\$ 46.50
2	MATERIAL	\$ 170.00	
1	LABOR	\$ 301.50	\$ 46.50
4	MATERIAL	\$ 255.00	
1	LABOR	\$ 216.50	\$ 46.50
2	MATERIAL	\$ 170.00	
1	LABOR	\$ 216.50	\$ 46.50
2	MATERIAL	\$ 170.00	
2	LABOR	\$ 348.00	\$ 93.00
4	MATERIAL	\$ 255.00	
1	LABOR	\$ 392.00	\$ 97.00
8	MATERIAL	\$ 295.00	
4	LABOR	\$ 627.00	\$ 372.00
4	MATERIAL	\$ 255.00	
2	LABOR	\$ 348.00	\$ 93.00
4	MATERIAL	\$ 255.00	
8	LABOR	\$ 1,817.00	\$ 372.00
32	MATERIAL	\$ 1,445.00	
12	LABOR	\$ 1,493.00	\$ 558.00
20	MATERIAL	\$ 935.00	
1	LABOR	\$ 641.50	\$ 46.50
12	MATERIAL	\$ 595.00	
1	LABOR	\$ 641.50	\$ 46.50
12	MATERIAL	\$ 595.00	
6	LABOR	\$ 1,044.00	\$ 279.00
16	MATERIAL	\$ 765.00	
1	LABOR	\$ 811.50	\$ 46.50
16	MATERIAL	\$ 765.00	
1	LABOR	\$ 301.50	\$ 46.50
4	MATERIAL	\$ 255.00	
6	LABOR	\$ 704.00	\$ 279.00
8	MATERIAL	\$ 425.00	

1	216.50	-	-
\$			
1	301.50	-	-
\$			
1	216.50	-	-
\$			
1	216.50	-	-
\$			
1	348.00	-	-
\$			
1	392.00	-	-
\$			
1	627.00	-	-
\$			
1	348.00	-	-
\$			
1	1,817.00	-	-
\$			
1	1,493.00	-	-
\$			
1	641.50	-	-
\$			
1	641.50	-	-
\$			
1	1,044.00	-	-
\$			
1	811.50	-	-
\$			
1	301.50	-	-
\$			
1	704.00	-	-
\$			

1104 Bourbon	Concrete	Remove and replace subsided granite curb and side walk adjacent.	Minor Hazard		
1112 Bourbon	Concrete	Remove and replace subsided granite curb and side walk adjacent.	Hazard		
1137 Bourbon-	Concrete	Subsidence below slab. Demo sidewalk fill (?) and Pave	Major Hazard		
928-30 Bourbon	Concrete	Remove and replace damaged Slate Tiles repair Joints	Minor Hazard		
1126 Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk	Minor Hazard		
1132 Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk	Hazard		
1134-36 Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk	Hazard		
1200 Bourbon	Concrete	Remove and replace damaged concrete sidewalk.	Hazard		
1206 Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk	Hazard		
1210 Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk (non conforming slope)	Hazard		
1214-20? Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk	Minor Hazard		
1224 Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk	Hazard		
1228 Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk	Minor Hazard		
1232 Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk	Hazard		
1240 Bourbon	Concrete	Curb Subsidence, remove replace repair Sidewalk	Hazard		

60	LABOR	\$ 5,748.75	\$ 543.75
120	MATERIAL		\$ 5,205.00
40	LABOR	\$ 3,888.75	\$ 383.75
80	MATERIAL		\$ 3,505.00
225	LABOR	\$ 10,468.75	\$ 1,863.75
200	MATERIAL		\$ 8,605.00
4	LABOR	\$ 1,108.00	\$ 133.00
20	MATERIAL		\$ 975.00
40	LABOR	\$ 2,188.75	\$ 383.75
40	MATERIAL		\$ 1,805.00
145	LABOR	\$ 4,728.75	\$ 1,223.75
80	MATERIAL		\$ 3,505.00
160	LABOR	\$ 3,998.75	\$ 1,343.75
60	MATERIAL		\$ 2,655.00
180	LABOR	\$ 5,008.75	\$ 1,503.75
80	MATERIAL		\$ 3,505.00
80	LABOR	\$ 2,508.75	\$ 703.75
40	MATERIAL		\$ 1,805.00
120	LABOR	\$ 2,828.75	\$ 1,023.75
40	MATERIAL		\$ 1,805.00
25	LABOR	\$ 2,068.75	\$ 263.75
40	MATERIAL		\$ 1,805.00
40	LABOR	\$ 3,888.75	\$ 383.75
80	MATERIAL		\$ 3,505.00
25	LABOR	\$ 2,918.75	\$ 263.75
60	MATERIAL		\$ 2,655.00
210	LABOR	\$ 6,948.75	\$ 1,743.75
120	MATERIAL		\$ 5,205.00
180	LABOR	\$ 6,708.75	\$ 1,503.75
120	MATERIAL		\$ 5,205.00

		1	5,748.75	-	-
		1	-	3,888.75	-
		1	-	-	10,468.75
		1	1,108.00	-	-
		1	2,188.75	-	-
		1	-	4,728.75	-
		1	-	3,998.75	-
		1	-	5,008.75	-
		1	-	2,508.75	-
		1	-	2,828.75	-
		1	2,068.75	-	-
		1	-	3,888.75	-
		1	2,918.75	-	-
		1	-	6,948.75	-
		1	-	6,708.75	-

OWNER	3	MAJOR HAZARD	2
SWB	7	HAZARD	22
OTHER	26	MINOR HAZARD	12
	36		36

[illegible]

534 Dauphine	BRICK	Replace 1" brick paver	Minor Hazard	
622 Dauphine	CONCRETE	Sidewalk repair at water meters. Underway?	Hazard	
636 Dauphine	CONCRETE	Driveway replace at sidewalk	Minor Hazard	
700 Dauphine	CONCRETE	Leak at water meter shutoff	Major Hazard	
740 Dauphine	CONCRETE	Fill termite port - multiple locations	Hazard	
814 Dauphine	CONCRETE	Non conforming repair, remove replace concrete	Hazard	
820 Dauphine	CONCRETE	Replace reset curb. 6'	Minor Hazard	
820 Dauphine	CONCRETE	Cox utility box re install	Hazard	
DAUPHINE 822	CONCRETE	8' of 60" curb and sidewalk repair.	HAZARD	
900 Dauphine	CONCRETE	Curb repair 6'	Minor Hazard	

3	LABOR	\$ 362.75	\$ 87.75
4	LABOR	\$ 275.00	
16	LABOR	\$ 1,996.75	\$ 191.75
40	LABOR	\$ 1,805.00	
108	LABOR	\$ 3,582.75	\$ 927.75
60	LABOR	\$ 2,655.00	
1	LABOR	\$ 219.25	\$ 71.75
1	LABOR	\$ 147.50	
4	LABOR	\$ 540.75	\$ 95.75
8	LABOR	\$ 445.00	
40	LABOR	\$ 3,888.75	\$ 383.75
80	LABOR	\$ 3,505.00	
1	LABOR	\$ 1,876.75	\$ 71.75
40	LABOR	\$ 1,805.00	
8	LABOR	\$ 1,082.75	\$ 127.75
20	LABOR	\$ 955.00	
480	LABOR	\$ 14,208.75	\$ 3,903.75
240	LABOR	\$ 10,305.00	
1	LABOR	\$ 1,196.75	\$ 71.75
24	LABOR	\$ 1,125.00	

			1	362.75	-	-
			1	-	1,996.75	-
			1	3,582.75	-	-
			1	-	-	219.25
		1	-	540.75	-	-
			1	-	3,888.75	-
			1	1,876.75	-	-
			1	-	1,082.75	-
			1	-	14,208.75	-
			1	1,196.75	-	-

916 Dauphine	CONCR ETE	Ballard repair replace	Minor Hazard		
1000 Dauphine	BRICK	10" curb subsidence and joint failure	Minor Hazard	Minor Hazard	
1112 Dauphine	CONCR ETE	Ballard replace repair	Minor Hazard	Minor Hazard	
1116 Dauphine	CONCR ETE	Water leak, subsidence	Major Hazard	Major Hazard	
1220 Dauphine	CONCR ETE	Curb replacement	Hazard	Hazard	
Dauphine 609	CONCR ETE	Repair replace light pole and utility box 2' x 4'	Hazard	Hazard	
Dauphine 541	BRICK	Cox access box 4' x 6' brick	Hazard	Hazard	
Dauphine 509	SLATE	Repair or place slate tile rep joints	Hazard	Hazard	
Dauphine 415	BRICK	Loose and missing bricks 2' x 5'	Hazard	Hazard	
Dauphine 425	BRICK	Recessed electric access 9" DIA. Reset flush	Hazard	Hazard	

4	LABOR	\$ 1,220.75	\$ 95.75
24	MATERIAL	\$ 1,125.00	
20	LABOR	\$ 2,715.00	\$ 930.00
40	MATERIAL	\$ 1,785.00	
4	LABOR	\$ 880.75	\$ 95.75
16	MATERIAL	\$ 785.00	
60	LABOR	\$ 5,748.75	\$ 543.75
120	MATERIAL	\$ 5,205.00	
2	LABOR	\$ 1,884.75	\$ 79.75
40	MATERIAL	\$ 1,805.00	
16	LABOR	\$ 1,316.75	\$ 191.75
24	MATERIAL	\$ 1,125.00	
12	LABOR	\$ 1,493.00	\$ 558.00
20	MATERIAL	\$ 935.00	
4	LABOR	\$ 1,278.00	\$ 133.00
24	MATERIAL	\$ 1,145.00	
12	LABOR	\$ 1,663.00	\$ 558.00
24	MATERIAL	\$ 1,105.00	
4	LABOR	\$ 255.00	\$ -
4	MATERIAL	\$ 255.00	

1	1,220.75	-	-
1	2,715.00	-	-
1	880.75	-	-
1	-	-	5,748.75
1	-	1,884.75	-
1	-	1,316.75	-
1	-	1,493.00	-
1	-	1,278.00	-
1	-	1,663.00	-
1	-	255.00	-

Dauphine 301	BRICK	Missing brick. 4" DIA	 Hazard	
Dauphine 241	BRICK	Replace brick at LP base 2'x 3'	 Hazard	
Dauphine 100 bulk	BRICK	Repair replace granite curb at 3 location approx 4' each	 MINOR Hazard	
Dauphine 1201	CONCR ETE	Subsided walk 8' x 40'	 Hazard	
Dauphine 1011	CONCR ETE	Subsided walk 25' x 7'	 Hazard	
Dauphine 941	CONCR ETE	Reset cox cable box 3' x 5'	 MINOR Hazard	
Dauphine 937	CONCR ETE	SWB 3'x3' REPLACE WALK	 MINOR Hazard	
Dauphine 909	BRICK	SWB 3x3 bro	 MINOR Hazard	

1

4

8

4

6

40

320

200

175

160

15

24

9

8

10

8

	LABOR	MATERIAL	
\$	301.50	\$ 46.50	
	\$	255.00	
\$	627.00	\$ 372.00	
	\$	255.00	
\$	2,064.00	\$ 279.00	
	\$	1,785.00	
\$	11,228.75	\$ 2,623.75	
	\$	8,605.00	
\$	8,368.75	\$ 1,463.75	
	\$	6,905.00	
\$	1,308.75	\$ 183.75	
	\$	1,125.00	
\$	580.75	\$ 135.75	
	\$	445.00	
\$	890.00	\$ 465.00	
	\$	425.00	
\$	-	\$ -	
\$	-		

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

\$ 95,075.50
\$ -





\$ 2,642.25 \$ 11,485.00 \$ 80,948.25
\$ - \$ - \$ -
\$ 2,642.25 \$ 11,485.00 \$ 80,948.25


\$ 17,617.00 \$ 71,490.50 \$ 5,968.00

\$ 95,075.50
\$ -
\$ 95,075.50

BURGUNDY STREET

OWNER	0	MAJOR HAZARD	1
SWB	10	HAZARD	29
OTHER	40	MINOR HAZARD	20
	50		50

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER		MINOR	HAZARD	MAJOR
Burgundy 100 block	BRICK	Fill termite trap void	MINOR Hazard		1			\$ 174.00	\$ 46.50		0%				1		174.00	-	-
					1				\$ 127.50			\$							
Burgundy 129 block	CONCRETE	Under construction	Hazard					\$ -	\$ -		0%						-	-	-
									\$ -			\$							
Burgundy 301	CONCRETE	Non compliant drain installation.	Minor Hazard		144			\$ 3,870.75	\$ 1,215.75		0%			1			3,870.75	-	-
					60				\$ 2,655.00			\$							
Burgundy 625	BRICK	Curb subsided 30" replace plant box 3' x 3' two each	Minor Hazard		20			\$ 2,715.00	\$ 930.00		0%				1		2,715.00	-	-
					40				\$ 1,785.00			\$							
Burgundy 631	CONCRETE	Repair replace 3 tree boxes 4' x 4'	Minor Hazard		32			\$ 3,273.00	\$ 1,488.00		0%				1		3,273.00	-	-
					40				\$ 1,785.00			\$							
Burgundy 713	CONCRETE	SWB replace sidewalk 7' x 12'	Hazard		84			\$ 2,540.75	\$ 735.75		0%			1			-	2,540.75	-
					40				\$ 1,805.00			\$							
Burgundy 731	CONCRETE	Subsided curb replacement sidewalk 15'x 7'	Hazard		105			\$ 4,068.75	\$ 903.75		0%				1		-	4,068.75	-
					72				\$ 3,165.00			\$							
Burgundy 811	BRICK	Subsided curb non compliant repair 30"	Hazard		12			\$ 2,343.00	\$ 558.00		0%				1		-	2,343.00	-
					40				\$ 1,785.00			\$							
Burgundy 829	BRICK	Missing and subsided curb 30"	Hazard		30			\$ 3,180.00	\$ 1,395.00		0%				1		-	3,180.00	-
					40				\$ 1,785.00			\$							
Burgundy 835	CONCRETE	Subsided and missing curb 30"	Hazard		12			\$ 1,964.75	\$ 159.75		0%				1		-	1,964.75	-
					40				\$ 1,805.00			\$							

Burgundy 837	CONCRETE	SWB sidewalk rep 7' x7'	 Hazard	
Burgundy 913	CONCRETE	Subsided curb 55'	 Hazard	
Burgundy 933	CONCRETE	Subsided curb and sidewalk 7'x15'	 Hazard	
Burgundy 939	CONCRETE	Subsided curb and sidewalk 20'x9'	 Hazard	
Burgundy 1001	CONCRETE	SWB repair sidewalk 8' x10'	 Major Hazard	
Burgundy 1021	CONCRETE	Subsided curb 30'. SWB repair 5'x5'	 Hazard	
Burgundy 1021 WLL TV	CONCRETE	Subsided curb 16'. & sidewalk repair. 5x5'	 Hazard	
Burgundy 1035	CONCRETE	SWB repair replace 10' x10'	 Hazard	
Burgundy 1041	CONCRETE	Replace two plant box 4x4'	 Hazard	
Burgundy 1101	CONCRETE	Ballard replace remove replace concrete sw 5'x 8'	 Hazard	
Burgundy 1109	CONCRETE	Remove replace dead vegetation	 Hazard	


49	MATERIAL	\$ 1,580.75	\$ 455.75
24	LABOR		\$ 1,125.00
55	MATERIAL	\$ 3,158.75	\$ 503.75
60	LABOR		\$ 2,655.00
105	MATERIAL	\$ 7,808.75	\$ 903.75
160	LABOR		\$ 6,905.00
180	MATERIAL	\$ 6,708.75	\$ 1,503.75
120	LABOR		\$ 5,205.00
80	MATERIAL	\$ 5,908.75	\$ 703.75
120	LABOR		\$ 5,205.00
25	MATERIAL	\$ 3,768.75	\$ 263.75
80	LABOR		\$ 3,505.00
57	MATERIAL	\$ 3,174.75	\$ 519.75
60	LABOR		\$ 2,655.00
100	MATERIAL	\$ 1,988.75	\$ 863.75
24	LABOR		\$ 1,125.00
32	MATERIAL	\$ 3,824.75	\$ 319.75
80	LABOR		\$ 3,505.00
40	MATERIAL	\$ 2,188.75	\$ 383.75
40	LABOR		\$ 1,805.00
16	MATERIAL	\$ 976.75	\$ 191.75
16	LABOR		\$ 785.00

0%	1	-	1,580.75	-
\$				
0%	1	-	3,158.75	-
\$				
0%	1	-	7,808.75	-
\$				
0%	1	-	6,708.75	-
\$				
0%	1	-	-	5,908.75
\$				
0%	1	-	3,768.75	-
\$				
0%	1	-	3,174.75	-
\$				
0%	1	-	1,988.75	-
\$				
0%	1	-	3,824.75	-
\$				
0%	1	-	2,188.75	-
\$				
0%	1	-	976.75	-
\$				

Burgundy 1117	BRICK	Subsided curb 30". Brick replacement 8" x8" concrete replace10" x4"	 Hazard	
Burgundy 1123	CONCRETE	Subsided curb 12" and sidewalk replacement 8' x 5'	 Hazard	
Burgundy 1125	CONCRETE	Subsided curb 20"	 Hazard	
Burgundy 1129	CONCRETE	Ballard replacement	 Hazard	
Burgundy 1135	CONCRETE	Subsided curb 20"	 Hazard	
Burgundy 1209	CONCRETE	Cable install SIDE WALK REPAIR 6 x 4 ft	 Hazard	
Burgundy 1215	CONCRETE	Replace 4 x6 concrete walk at Cox Cable instalation.	 Hazard	
Burgundy 1225	CONCRETE	Subsided curb 20"	 Hazard	
Burgundy 1313 Morro Castle	SLATE	SWB repair replace SLATE 8 X 6	 Hazard	
Burgundy 1319	CONCRETE	Subsided curb and rebuild planter box	 Hazard	
Burgundy 1323	CONCRETE	Sidewalk repair 7 x 3 foot	 Hazard	

224	64	MATERIAL	\$ 14,156.75	\$ 10,991.75
30	40	LABOR		\$ 3,165.00
40	40	MATERIAL	\$ 2,528.75	\$ 383.75
48		LABOR		\$ 2,145.00
40	40	MATERIAL	\$ 2,528.75	\$ 383.75
48		LABOR		\$ 2,145.00
5		MATERIAL	\$ 718.75	\$ 103.75
12		LABOR		\$ 615.00
40	40	MATERIAL	\$ 1,508.75	\$ 383.75
24		LABOR		\$ 1,125.00
24	24	MATERIAL	\$ 2,060.75	\$ 255.75
40		LABOR		\$ 1,805.00
24	24	MATERIAL	\$ 2,060.75	\$ 255.75
40		LABOR		\$ 1,805.00
4		MATERIAL	\$ 9,791.00	\$ 186.00
224		LABOR		\$ 9,605.00
6	6	MATERIAL	\$ 1,302.00	\$ 157.00
24		LABOR		\$ 1,145.00
16	16	MATERIAL	\$ 1,316.75	\$ 191.75
24		LABOR		\$ 1,125.00
21	21	MATERIAL	\$ 2,036.75	\$ 231.75
40		LABOR		\$ 1,805.00

0%	1	-	14,156.75	-
\$				
0%	1	-	2,528.75	-
\$				
0%	1	-	2,528.75	-
\$				
0%	1	-	718.75	-
\$				
0%	1	-	1,508.75	-
\$				
0%	1	-	2,060.75	-
\$				
0%	1	-	2,060.75	-
\$				
0%	1	-	9,791.00	-
\$				
0%	1	-	1,302.00	-
\$				
0%	1	-	1,316.75	-
\$				
0%	1	-	2,036.75	-
\$				

Burgundy 326	CONCRETE	Replace non compliant drive. 15' x 3'	 MINOR Hazard	
Burgundy 540	CONCRETE	Missing Ballard. Fill or replace	 MINOR Hazard	
Burgundy 610	CONCRETE	Subsided curb, 40'	 MINOR Hazard	
Burgundy 626	CONCRETE	Subsided curb 15'	 MINOR Hazard	
Burgundy 700	CONCRETE	Subsided curb 70'	 MINOR Hazard	
Burgundy 800	CONCRETE	Subsided curb 24'	 MINOR Hazard	
Burgundy 814	CONCRETE	Curb damage two locations 8' x 2'	 Hazard	
Burgundy 818	CONCRETE	Subsided curb 10'	 MINOR Hazard	
Burgundy 840	CONCRETE	Non compliant drive access 15' x 8'	 Hazard	
Burgundy 940	CONCRETE	Subsided curb 40'	 MINOR Hazard	
Burgundy 924	CONCRETE	Subsided curb, Holly Oak planter box. Reset 25' curb	 MINOR Hazard	

45	MATERIAL	\$ 2,568.75	\$ 423.75
48	LABOR	\$ 2,145.00	
1	MATERIAL	\$ 261.75	\$ 71.75
2	LABOR	\$ 190.00	
5	MATERIAL	\$ 3,608.75	\$ 103.75
80	LABOR	\$ 3,505.00	
30	MATERIAL	\$ 2,108.75	\$ 303.75
40	LABOR	\$ 1,805.00	
140	MATERIAL	\$ 4,688.75	\$ 1,183.75
80	LABOR	\$ 3,505.00	
48	MATERIAL	\$ 2,252.75	\$ 447.75
40	LABOR	\$ 1,805.00	
16	MATERIAL	\$ 1,316.75	\$ 191.75
24	LABOR	\$ 1,125.00	
20	MATERIAL	\$ 2,028.75	\$ 223.75
40	LABOR	\$ 1,805.00	
120	MATERIAL	\$ 2,828.75	\$ 1,023.75
40	LABOR	\$ 1,805.00	
80	MATERIAL	\$ 2,508.75	\$ 703.75
40	LABOR	\$ 1,805.00	
50	MATERIAL	\$ 2,268.75	\$ 463.75
40	LABOR	\$ 1,805.00	

0%	1	2,568.75	-	-
\$				
0%	1	261.75	-	-
\$				
0%	1	3,608.75	-	-
\$				
0%	1	2,108.75	-	-
\$				
0%	1	4,688.75	-	-
\$				
0%	1	2,252.75	-	-
\$				
0%	1	-	1,316.75	-
\$				
0%	1	2,028.75	-	-
\$				
0%	1	-	2,828.75	-
\$				
0%	1	2,508.75	-	-
\$				
0%	1	2,268.75	-	-
\$				

Burgundy 928	CONCRETE	Subsided curb 8'	 MINOR Hazard	
Burgundy 1022 - 1030	CONCRETE	Subsided curb 70'	 MINOR Hazard	
Burgundy1100	CONCRETE	Ballard missing replace or <u>patch</u>	 MINOR Hazard	
Burgundy 1114	BRICK	Subsided curb non compliant brick and slate walk. 10' curb 4x8 walk split	 MINOR Hazard	
Burgundy 1140	CONCRETE	10' subsided curb	 MINOR Hazard	
Burgundy 1200	CONCRETE	Sidewalk replace 5 x 8', 2' x 35' & curb repair 5'	 Hazard	
Burgundy 1204	CONCRETE	Subsided curb 6'	 MINOR Hazard	
Burgundy 1230 Cabrini Pk	CONCRETE	16' subsided curb replace	 MINOR Hazard	

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

16	MATERIAL	\$ 1,996.75	\$ 191.75
40	LABOR		\$ 1,805.00
140	MATERIAL	\$ 3,838.75	\$ 1,183.75
60	LABOR		\$ 2,655.00
1	MATERIAL	\$ 346.75	\$ 71.75
4	LABOR		\$ 275.00
24	MATERIAL	\$ 3,739.00	\$ 1,489.00
24	LABOR		\$ 2,250.00
20	MATERIAL	\$ 1,348.75	\$ 223.75
24	LABOR		\$ 1,125.00
110	MATERIAL	\$ 4,448.75	\$ 943.75
80	LABOR		\$ 3,505.00
12	MATERIAL	\$ 1,284.75	\$ 159.75
24	LABOR		\$ 1,125.00
32	MATERIAL	\$ 2,464.75	\$ 319.75
48	LABOR		\$ 2,145.00
	MATERIAL	\$ -	\$ -
	LABOR		\$ -
	MATERIAL	\$ -	\$ -
	LABOR		\$ -

\$ 151,137.50
\$ -

0%	1	1,996.75	-	-
		\$		
0%	1	3,838.75	-	-
		\$		
	1	346.75	-	-
		\$		
	1	3,739.00	-	-
		\$		
	1	1,348.75	-	-
		\$		
	1	-	4,448.75	-
		\$		
	1	1,284.75	-	-
		\$		
	1	2,464.75	-	-
		\$		
		\$		
		\$		

\$ - \$ 40,480.75 \$ 110,656.75
\$ - \$ - \$ -
\$ - \$ 40,480.75 \$ 110,656.75

\$ 47,348.00 \$ 97,880.75 \$ 5,908.75
\$151,137.50

\$151,137.50
\$ -
\$151,137.50

RAMPART STREET QTR SIDE

OWNER	0	MAJOR HAZARD	0
SWB	0	HAZARD	5
OTHER	14	MINOR HAZARD	9
	14		14

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
Rampart 1236	CONCRETE	Replace all 10'x75' walk subsided. Void under walk that might not hold pedestrians weight.	HAZARD		750			\$ 26,568.75	\$ 6,063.75						1	-	26,568.75	-
					480			\$ 20,505.00				\$						
Rampart 1130	CONCRETE	Replace 10'x130' subsided walk. Curb	HAZARD		1300			\$ 36,068.75	\$ 10,463.75						1	-	36,068.75	-
					600			\$ 25,605.00				\$						
Rampart 1120	CONCRETE	SWB replace 10' x 10' walk and curb. Reset 35' of granite curb	HAZARD		100			\$ 7,768.75	\$ 863.75						1	-	7,768.75	-
					160			\$ 6,905.00				\$						
Rampart 1024	CONCRETE	Replace Holy oak. In 4'x4' planter	MINOR HAZARD		16			\$ 1,146.75	\$ 191.75						1	1,146.75	-	-
					20			\$ 955.00				\$						
Rampart 934	CONCRETE	Remove damaged concrete replace 10'x10' concrete walk .	HAZARD		100			\$ 2,668.75	\$ 863.75						1	-	2,668.75	-
					40			\$ 1,805.00				\$						
Rampart 914	CONCRETE	Replace 4' x15' drive and curb concrete	HAZARD		60			\$ 2,348.75	\$ 543.75						1	-	2,348.75	-
					40			\$ 1,805.00				\$						
Rampart 834	CONCRETE	Replace 20'x10' concrete walk	MINOR HAZARD		200			\$ 3,468.75	\$ 1,663.75						1	3,468.75	-	-
					40			\$ 1,805.00				\$						
Rampart 826	CONCRETE	Replace 10'x10' walk at cox utility box. Subsidied curb reset at elevation.	MINOR HAZARD		100			\$ 1,818.75	\$ 863.75						1	1,818.75	-	-
					20			\$ 955.00				\$						

Rampart 816	CONCRETE	Replace 30'x10 concrete walk.	 MINOR HAZARD	
Rampart 802	CONCRETE	Replace Palm Trees, 2 ea. Replace 10'x15' walk concrete	 MINOR HAZARD	
Rampart 700 Block	CONCRETE	Replace 60% of 10' x 160' walk. Reset curb	 MINOR HAZARD	
Rampart 718	CONCRETE	Replace 10'x25' concrete walk	 MINOR HAZARD	
Rampart 632 - 622	CONCRETE	Replace degraded walk 10'x105.	 MINOR HAZARD	
Rampart 420	CONCRETE	Replace 4'x12 sidewalk at construction joint	 MINOR HAZARD	

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

300	MATERIAL	\$ 5,968.75	\$ 2,463.75
80	LABOR		\$ 3,505.00
150	MATERIAL	\$ 6,468.75	\$ 1,263.75
120	LABOR		\$ 5,205.00
960	MATERIAL	\$ 24,848.75	\$ 7,743.75
400	LABOR		\$ 17,105.00
250	MATERIAL	\$ 8,968.75	\$ 2,063.75
160	LABOR		\$ 6,905.00
1050	MATERIAL	\$ 18,768.75	\$ 8,463.75
240	LABOR		\$ 10,305.00
48	MATERIAL	\$ 3,952.75	\$ 447.75
80	LABOR		\$ 3,505.00
	MATERIAL	\$ -	\$ -
	LABOR		\$ -

\$ 150,834.50
\$ -

		1	5,968.75	-	-
	\$				
		1	6,468.75	-	-
	\$				
		1	24,848.75	-	-
	\$				
		1	8,968.75	-	-
	\$				
		1	18,768.75	-	-
	\$				
		1	3,952.75	-	-
	\$				

\$ - \$ - \$ 150,834.50
\$ - \$ - \$ -
\$ - \$ - \$ 150,834.50


\$ 75,410.75 \$ 75,423.75 \$ -
\$ -
\$ 150,834.50

OWNER	0	MAJOR HAZARD	0
SWB	0	HAZARD	11
OTHER	12	MINOR HAZARD	1
	12		12

OWNER	0	MAJOR HAZARD	0
SWB	0	HAZARD	11
OTHER	12	MINOR HAZARD	1
	12		12

BARRACKS STREET

OWNER 0 MAJOR HAZARD 1
SWB 0 HAZARD 10
OTHER 14 MINOR HAZARD 3
14 14

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER		MINOR	HAZARD	MAJOR
Barracks 600	CONCRETE	Replace subsided walk 7'x8'	HAZARD		56			\$ 2,316.75	\$ 511.75						1		-	2,316.75	-
					40				\$ 1,805.00			\$							
Barracks 600-626	CONCRETE	Construction	HAZARD					\$ -	\$ -			\$ -	-				-	-	-
									\$ -										
Barracks 700	CONCRETE	Replace subsided curb and walk 7'x30'	HAZARD		210			\$ 5,248.75	\$ 1,743.75						1		-	5,248.75	-
					80				\$ 3,505.00			\$							
Barracks 710	CONCRETE	Replace subsided walk 8'x10'	MAJOR HAZARD		80			\$ 5,908.75	\$ 703.75						1		-	-	5,908.75
					120				\$ 5,205.00			\$							
Barracks 714-718	CONCRETE	Replace subsided walk 8'x35'	HAZARD		280			\$ 5,808.75	\$ 2,303.75						1		-	5,808.75	-
					80				\$ 3,505.00			\$							
Barracks 802	CONCRETE	Replace subsided curb and walk 8'x75'	HAZARD		600			\$ 15,168.75	\$ 4,863.75						1		-	15,168.75	-
					240				\$ 10,305.00			\$							
Barracks 812	CONCRETE	Replace concrete walk 7'x40'	HAZARD		280			\$ 7,508.75	\$ 2,303.75						1		-	7,508.75	-
					120				\$ 5,205.00			\$							
Barracks 822	CONCRETE	Replace concrete drive 8'x10' non conforming curb	HAZARD		80			\$ 2,508.75	\$ 703.75						1		-	2,508.75	-
					40				\$ 1,805.00			\$							
Barracks 900 blocks	CONCRETE	Replace subsided curb and walk 7'x305'	HAZARD		2135			\$ 51,248.75	\$ 17,143.75						1		-	51,248.75	-
					800				\$ 34,105.00			\$							
Barracks 1000 Block	CONCRETE	Under construction	HAZARD					\$ -	\$ -								-	-	-
									\$ -			\$							
Barracks 901	CONCRETE	Replace subsided curb and walk 2.5'x40'	MINOR HAZARD		100			\$ 4,368.75	\$ 863.75						1		4,368.75	-	-
					80				\$ 3,505.00			\$							
Barracks 741	CONCRETE	Replace subsided curb and walk 8'x35'	HAZARD		280			\$ 7,508.75	\$ 2,303.75						1		-	7,508.75	-
					120				\$ 5,205.00			\$							
Barracks 627 - 629	CONCRETE	Subsided curb and walk replace at elevation 7'x35'	HAZARD		245			\$ 7,228.75	\$ 2,023.75						1		-	7,228.75	-
					120				\$ 5,205.00			\$							

GOV NICHOLLS STREET

OWNER	1	MAJOR HAZARD	1
SWB	2	HAZARD	19
OTHER	24	MINOR HAZARD	7
	27		27

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
Gov Nichols 400	CONCRETE	Reset 100' granite curb, replace 4'x100' concrete walk. Patch three 1'x1' holes.	HAZARD		400			\$ 8,468.75	\$ 3,263.75						1	-	8,468.75	-
					120				\$ 5,205.00			↗						
Gov Nichols 700	CONCRETE	Replace subsided concrete walk and granite curb7'x12"	HAZARD		64			\$ 4,080.75	\$ 575.75						1	-	4,080.75	-
					80				\$ 3,505.00			↗						
Gov Nichols 724	CONCRETE	Replace drive and walk reset curb to elev. 7'x 20' concrete	MAJOR HAZARD		140			\$ 5,538.75	\$ 1,183.75						1	-	-	5,538.75
					100				\$ 4,355.00			↗						
Gov Nichols 726	CONCRETE	Replace palm or remove stump and replace concrete walk 7'x30'	HAZARD		120			\$ 4,528.75	\$ 1,023.75						1	-	4,528.75	-
					80				\$ 3,505.00			↗						
Gov Nichols 728	CONCRETE	Replace palm or remove stump and replace concrete walk 7'x12"	HAZARD		84			\$ 2,540.75	\$ 735.75						1	-	2,540.75	-
					40				\$ 1,805.00			↗						
Gov Nichols 736	CONCRETE	Replace concrete walk at tree 8' x20'	HAZARD		160			\$ 4,848.75	\$ 1,343.75						1	-	4,848.75	-
					80				\$ 3,505.00			↗						
Gov Nichols 924-926	CONCRETE	Replace non compliant drive 15'x10'	HAZARD		150			\$ 4,768.75	\$ 1,263.75						1	-	4,768.75	-
					80				\$ 3,505.00			↗						
Gov Nichols 932	CONCRETE	Reset brick in fish one pattern at abandon planter. 2'x2'	HAZARD		4			\$ 880.75	\$ 95.75				1			-	880.75	-
					16				\$ 785.00			↗						
Gov Nichols 1040	CONCRETE	Replace subsiding 8'x115' concrete walk. Reset curb to elev	MINOR HAZARD		920			\$ 19,428.75	\$ 7,423.75						1	19,428.75	-	-
					280				\$ 12,005.00			↗						
Gov Nichols 1031	CONCRETE	Replace 7'x15' concrete walk	HAZARD		105			\$ 4,408.75	\$ 903.75						1	-	4,408.75	-
					80				\$ 3,505.00			↗						

Gov Nichols 1029	CONCRETE	Reset subsided curb and replace 7'x35' walk w planters	HAZARD	 
Gov Nichols 1025-1027	CONCRETE	Replace 7'x35' concrete walk w two drive Ways. RESET STONE CURB 12"	HAZARD	 
Gov Nichols 1005	CONCRETE	Reset subsided curb replace 7'x35' concrete walk	HAZARD	 
Gov Nichols 1003	CONCRETE	Remove PIPE (non conforming bullard) place 7'x35' concrete walk and two tree planter and curb.	HAZARD	 
Gov Nichols 935 - 939	CONCRETE	Replace 75% of 7'x60' concrete walk. Rest 60' curb.	HAZARD	 
Gov Nichols 931	CONCRETE	Reset curb 30'. Repair 1'x3' concrete walk	HAZARD	 
Gov Nichols 913	CONCRETE	Replace 7'x75' concrete walk. Reset granite curb at elevation and replace 15' damaged	HAZARD	 
Gov Nichols 901	CONCRETE	Replace subsided 7'x60' concrete walk	MINOR HAZARD	 
Gov Nichols 832-837	CONCRETE	Replace 7' x 135' concrete walk, rebuild three tree planters replace damaged curb with granite.	HAZARD	 

245	MATERIAL	\$ 7,228.75	\$ 2,023.75
120	LABOR		\$ 5,205.00
245	MATERIAL	\$ 7,228.75	\$ 2,023.75
120	LABOR		\$ 5,205.00
245	MATERIAL	\$ 7,228.75	\$ 2,023.75
120	LABOR		\$ 5,205.00
245	MATERIAL	\$ 7,228.75	\$ 2,023.75
120	LABOR		\$ 5,205.00
342	MATERIAL	\$ 9,704.75	\$ 2,799.75
160	LABOR		\$ 6,905.00
120	MATERIAL	\$ 4,528.75	\$ 1,023.75
80	LABOR		\$ 3,505.00
525	MATERIAL	\$ 17,968.75	\$ 4,263.75
320	LABOR		\$ 13,705.00
420	MATERIAL	\$ 17,128.75	\$ 3,423.75
320	LABOR		\$ 13,705.00
945	MATERIAL	\$ 24,728.75	\$ 7,623.75
400	LABOR		\$ 17,105.00

		1	7,228.75	
		1	7,228.75	
		1	7,228.75	
		1	9,704.75	
		1	4,528.75	
		1	17,968.75	
		1	17,128.75	
		1	24,728.75	

Gov Nichols 811-821	CONCRETE	Replace 7'x55' concrete walk	 MINOR HAZARD	
Gov Nichols 809	CONCRETE	SWB replace 4' X4' WALK. REMAINING 7'x40' concrete walk NEED REPLACEMENT	 HAZARD	
Gov Nichols 800	CONCRETE	Rebuild non compliant planter boxes, restore 7'x60' concrete walk	 HAZARD	
Gov Nichols 739	CONCRETE	Replace subsided curb 100', replace 7'x100' concrete walk	 MINOR HAZARD	
Gov Nichols 703-723	CONCRETE	Replace subsided curb and walk 7'x135'	 MINOR HAZARD	
Gov Nichols 639	CONCRETE	Replace 7'x35' concrete walk	 MINOR HAZARD	
Gov Nichols 609 & 619	CONCRETE	8'x135' subsided curb. Replace concrete walk 8'x90'	 HAZARD	
Gov Nichols 401	SLATE	Reset 12'x25' slate walk. Level regrout and repair,	 MINOR HAZARD	

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

385	MATERIAL	\$ 10,048.75	\$ 3,143.75
160	LABOR		\$ 6,905.00
280	MATERIAL	\$ 8,358.75	\$ 2,303.75
140	LABOR		\$ 6,055.00
420	MATERIAL	\$ 15,428.75	\$ 3,423.75
280	LABOR		\$ 12,005.00
700	MATERIAL	\$ 19,368.75	\$ 5,663.75
320	LABOR		\$ 13,705.00
945	MATERIAL	\$ 25,578.75	\$ 7,623.75
420	LABOR		\$ 17,955.00
245	MATERIAL	\$ 7,228.75	\$ 2,023.75
120	LABOR		\$ 5,205.00
1080	MATERIAL	\$ 26,658.75	\$ 8,703.75
420	LABOR		\$ 17,955.00
300	MATERIAL	\$ 10,610.00	\$ 3,685.00
160	LABOR		\$ 6,925.00
	MATERIAL	\$ -	\$ -
	LABOR		\$ -

\$ 285,749.50
\$ -

			1	10,048.75	-	-
			1	-	8,358.75	-
			1	-	15,428.75	-
			1	19,368.75	-	-
			1	25,578.75	-	-
			1	7,228.75	-	-
			1	-	26,658.75	-
			1	10,610.00	-	-



\$ 880.75 \$ 33,937.50 \$ 250,931.25
\$ - \$ - \$ -
\$ 880.75 \$ 33,937.50 \$ 250,931.25

\$ 109,392.50 \$ 170,818.25 \$ 5,538.75

\$ 285,749.50
\$ -
\$ 285,749.50


OWNER	0	MAJOR HAZARD	4
SWB	2	HAZARD	27
OTHER	30	MINOR HAZARD	1
	32		32

[illegible]

Urulines 620	CONCRETE	Reset or replace 30' of 120 subsided curb Complete sidewalk repair at two light pole 2' x 4' each.	HAZARD	
Urulines 700 (1041 Royal)	CONCRETE	75' curb subsidence, 2' sidewalk replacement.	HAZARD	
Urulines 708	BRICK	65' curb subsidence 2' Brick fail way.	HAZARD	
Urulines 718	CONCRETE	SWB subsidence affecting 30' x 30' Street and sidewalk curb. Sidewalk and curb 30' x 9'	HAZARD	
Urulines 728&726	CONCRETE	Non compliant sidewalk repair 12x5'	MINOR HAZARD	
Urulines 730	CONCRETE	SWB street cave in caused subsided curb and sidewalk 30' x 20'	HAZARD	
Urulines 734	CONCRETE	15' subsided curb, patch walk 2' x 2'	HAZARD	
Urulines 800. (Burgundy 1041)	CONCRETE	65' subsided curb and sidewalk 9'	HAZARD	
Urulines 812	CONCRETE	Subsided curb 35'	HAZARD	
Urulines 816 & 818	CONCRETE	35' curbs and side walk 6' replace	HAZARD	
Urulines 820 & 822	CONCRETE	35' x 5' curb and Sidewalk replace	HAZARD	
Urulines 826 & 824	CONCRETE	30' subsided curb 7' SIDEWALK REPLACE	HAZARD	
Urulines 840	CONCRETE	Add 20' subsided curb and 20x 4' sidewalk replacement	MAJOR HAZARD	

40	MATERIAL	\$ 3,888.75	\$ 383.75
80	LABOR	\$ 3,505.00	
150	MATERIAL	\$ 9,868.75	\$ 1,263.75
200	LABOR	\$ 8,605.00	
450	MATERIAL	\$ 29,510.00	\$ 20,925.00
200	LABOR	\$ 8,585.00	
900	MATERIAL	\$ 27,768.75	\$ 7,263.75
480	LABOR	\$ 20,505.00	
60	MATERIAL	\$ 2,348.75	\$ 543.75
40	LABOR	\$ 1,805.00	
600	MATERIAL	\$ 25,368.75	\$ 4,863.75
480	LABOR	\$ 20,505.00	
4	MATERIAL	\$ 540.75	\$ 95.75
8	LABOR	\$ 445.00	
594	MATERIAL	\$ 30,420.75	\$ 4,815.75
600	LABOR	\$ 25,605.00	
5	MATERIAL	\$ 10,470.00	\$ 145.00
240	LABOR	\$ 10,325.00	
210	MATERIAL	\$ 6,948.75	\$ 1,743.75
120	LABOR	\$ 5,205.00	
175	MATERIAL	\$ 6,668.75	\$ 1,463.75
120	LABOR	\$ 5,205.00	
210	MATERIAL	\$ 6,948.75	\$ 1,743.75
120	LABOR	\$ 5,205.00	
80	MATERIAL	\$ 9,308.75	\$ 703.75
200	LABOR	\$ 8,605.00	

		1	3,888.75	
		1	9,868.75	
		1	29,510.00	
		1	27,768.75	
		1	2,348.75	
		1	25,368.75	
		1	540.75	
		1	30,420.75	
		1	10,470.00	
		1	6,948.75	
		1	6,668.75	
		1	6,948.75	
		1	9,308.75	

Ursulines 840	CONCRETE	4' sidewalk repair noncompliant	 HAZARD	
Ursulines 900	CONCRETE	55' x 9' subsided sidewalk and curb.	 MAJOR HAZARD	
Ursulines 910	CONCRETE	Subsided curb and sidewalk 30' x 9'	 HAZARD	
Ursulines 930	CONCRETE	Subsided curb and sidewalk, 15' x 9' SWB	 HAZARD	
Ursulines 1000	CONCRETE	92' x 9' subsided curb and sidewalk	 MAJOR HAZARD	
Ursulines 1012	BRICK	Subsided curb, 32',	 HAZARD	
Ursulines 1020	CONCRETE	110' x 9' subsided curb and sidewalk, replace all	 MAJOR HAZARD	

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

16	MATERIAL	\$ 1,996.75	\$ 191.75
40	LABOR		\$ 1,805.00
495	MATERIAL	\$ 17,728.75	\$ 4,023.75
320	LABOR		\$ 13,705.00
270	MATERIAL	\$ 10,828.75	\$ 2,223.75
200	LABOR		\$ 8,605.00
135	MATERIAL	\$ 6,348.75	\$ 1,143.75
120	LABOR		\$ 5,205.00
828	MATERIAL	\$ 27,192.75	\$ 6,687.75
480	LABOR		\$ 20,505.00
200	MATERIAL	\$ 16,185.00	\$ 9,300.00
160	LABOR		\$ 6,885.00
990	MATERIAL	\$ 25,938.75	\$ 7,983.75
420	LABOR		\$ 17,955.00
	MATERIAL	\$ -	\$ -
	LABOR		\$ -


\$ 757,072.25
\$ -


			1			1,996.75	
			1				17,728.75
			1			10,828.75	
			1			6,348.75	
			1				27,192.75
			1			16,185.00	
			1				25,938.75

\$ - \$ 48,177.50 \$ 708,894.75
\$ - \$ - \$ -
\$ - \$ 48,177.50 \$ 708,894.75

\$ 2,348.75 \$ 674,554.50 \$ 80,169.00 \$ 757,072.25
\$ - \$ - \$ -
\$ - \$ 757,072.25



OWNER	0	MAJOR HAZARD	3
SWB	2	HAZARD	23
OTHER	31	MINOR HAZARD	7
	33		33

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
St Phillips 500	CONCRETE	SUBSIDED CURB AND WALK 9' X 60' REMOVE REPLACE.	HAZARD		600			\$ 15,168.75	\$ 4,863.75						1	-	15,168.75	-
					240				\$ 10,305.00			\$						
St Phillips 510 516	CONCRETE	SUBSIDED CURB AND WALK 4' X 12' REMOVE REPLACE.	HAZARD		48			\$ 3,952.75	\$ 447.75						1	-	3,952.75	-
					80				\$ 3,505.00			\$						
St Phillips 524	CONCRETE	REPLACE CURB AND SIDEWALK 7' X 50'	HAZARD		350			\$ 9,768.75	\$ 2,863.75						1	-	9,768.75	-
					160				\$ 6,905.00			\$						
St Phillips 540	CONCRETE	REPLACE CURB AND SIDEWALK 8' X 65'	HAZARD		520			\$ 11,128.75	\$ 4,223.75						1	-	11,128.75	-
					160				\$ 6,905.00			\$						
St Phillips 628	CONCRETE	SUBSIDED CURB AND WALK REMOVE REPLACE 8' X 12'	HAZARD		96			\$ 3,486.75	\$ 831.75						1	-	3,486.75	-
					60				\$ 2,655.00			\$						
St Phillips 700	SLATE	REMOVE REMNANT OF BALLARD AND SIGN BOLT BOLT SHANKS	HAZARD		0			\$ 210.00	\$ -						1	-	210.00	-
					2				\$ 210.00			\$						
St Phillips 740	CONCRETE	NON COMPLIANT REPAIR REMOVE REPLACE 4' X 80'	MINOR HAZARD		320			\$ 7,828.75	\$ 2,623.75						1	7,828.75	-	-
					120				\$ 5,205.00			\$						
St Phillips 808	CONCRETE	SUSIDED CURB AND WALK REMOVE REPLACE 5' X 25'	HAZARD		125			\$ 6,268.75	\$ 1,063.75						1	-	6,268.75	-
					120				\$ 5,205.00			\$						
St Phillips 840	CONCRETE	SUSIDED CURB AND WALK REMOVE REPLACE 5' X 20'	HAZARD		100			\$ 6,068.75	\$ 863.75						1	-	6,068.75	-
					120				\$ 5,205.00			\$						

St Phillips 926	BRICK	SUSIDDED CURB AND WALK REMOVE REPLACE 5' X 12'	 HAZARD		60
St Phillips 938	BRICK	SUBSIDED CURB AND WALK REMOVE REPLACE 9' X 20'	 HAZARD		180
St Phillips 1000	BRICK	NON COMPLIANT REPAIR REPLACE BRICK SIDEWALK AT 9' X 75'	 MINOR HAZARD		700
St Phillips 1012	BRICK	REMOVE REINST ALL BRICK AT SWB NON COMPLIANT INSTALLATION 9' X 30'	 MAJOR HAZARD		270
St Phillips 1014	CONCRETE	REPAIR CONCRETE AT 2 EA 2' X 2' HOLES	 MAJOR HAZARD		16
St Phillips 1028	BRICK	REPAIR CURB AND BRICK WALK AT 4' X 8'	 MAJOR HAZARD		32
St Phillips 1040	CONCRETE	REPAIR SIDEWALK AT METER 5' X 5'	 HAZARD		25
St Philip 503	BRICK	Reset 15'x7' brick pavers and fill Ballard hole remnants, level with existing.	 HAZARD		105

MATERIAL	
LABOR	\$ 7,975.00
	\$ 2,790.00
MATERIAL	
LABOR	\$ 16,955.00
	\$ 8,370.00
MATERIAL	
LABOR	\$ 42,835.00
	\$ 32,550.00
MATERIAL	
LABOR	\$ 27,940.00
	\$ 12,555.00
MATERIAL	
LABOR	\$ 636.75
	\$ 191.75
MATERIAL	
LABOR	\$ 2,593.00
	\$ 1,488.00
MATERIAL	
LABOR	\$ 1,048.75
	\$ 263.75
MATERIAL	
LABOR	\$ 6,667.50
	\$ 4,882.50
	\$ 1,785.00

		1	7,975.00	
		1	16,955.00	
		1	42,835.00	
		1	27,940.00	
		1	636.75	
		1	2,593.00	
		1	1,048.75	
		1	6,667.50	

St Philip 515	CONCRETE	Replace CONCRETE walk 15' x7'	HAZARD	
St Philip 533	CONCRETE	Replace walk and subsided curb 35'x7'	HAZARD	
St Philip 535	CONCRETE	Remove replace 25'x7' concrete walk and curb.	HAZARD	
St Philip 611	CONCRETE	Replace 10'x5' concrete walk	HAZARD	
St Philip 613	CONCRETE	Replace 15'x5' driveway entry	HAZARD	
St Philip 625	CONCRETE	Remove Ballard stub remnants, replace 4'x8' subsided walk.	HAZARD	
St Philip 631	CONCRETE	Replace curb and walk at 75'x5'.	HAZARD	
St Philip 639	CONCRETE	Repair concrete curb and walk 7'x4'.	HAZARD	
St Philip 701 elementary school.	CONCRETE	Replace concrete walk 20'x5', 5'x5', 25'x7', 20'x7', 4'x8'.	HAZARD	

105	HAZARD	MATERIAL	\$ 4,408.75	\$ 903.75
80	HAZARD	LABOR		\$ 3,505.00
245	HAZARD	MATERIAL	\$ 12,328.75	\$ 2,023.75
240	HAZARD	LABOR		\$ 10,305.00
175	HAZARD	MATERIAL	\$ 10,068.75	\$ 1,463.75
200	HAZARD	LABOR		\$ 8,605.00
50	HAZARD	MATERIAL	\$ 3,968.75	\$ 463.75
80	HAZARD	LABOR		\$ 3,505.00
75	HAZARD	MATERIAL	\$ 4,168.75	\$ 663.75
80	HAZARD	LABOR		\$ 3,505.00
32	HAZARD	MATERIAL	\$ 2,124.75	\$ 319.75
40	HAZARD	LABOR		\$ 1,805.00
375	HAZARD	MATERIAL	\$ 13,368.75	\$ 3,063.75
240	HAZARD	LABOR		\$ 10,305.00
28	HAZARD	MATERIAL	\$ 1,242.75	\$ 287.75
20	HAZARD	LABOR		\$ 955.00
595	HAZARD	MATERIAL	\$ 18,528.75	\$ 4,823.75
320	HAZARD	LABOR		\$ 13,705.00

			1	4,408.75	
			1	12,328.75	
			1	10,068.75	
			1	3,968.75	
			1	4,168.75	
			1	2,124.75	
			1	13,368.75	
			1	1,242.75	
			1	18,528.75	

St Philip 831	CONCRETE	Repair subsided curb and walk 5'x4'		
St Philip 841	BRICK	Repair plaster, install replacement tree.		
St Philip 927	CONCRETE	Fill Ballard hole, 6" dia. Repair concrete walk 1'x2'		
St Philip 1003	CONCRETE	Reset and level brick at walk. Fill to level elevation and surface. 7'X 20'		
St Philip 1009	BRICK	Replace brick walk 7'x35'		
St Philip 1025	CONCRETE	Replace concrete walk 7'x15'.		
St Philip 1029	CONCRETE	Reset Cox UTILITY box level with walk, replace concrete walk 5'x7'.		

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

20	HAZARD	\$ 1,348.75	\$ 223.75
24		\$ 1,125.00	
9	MINOR HAZARD	\$ 410.75	\$ 135.75
4		\$ 275.00	
4	HAZARD	\$ 540.75	\$ 95.75
8		\$ 445.00	
140	MINOR HAZARD	\$ 2,988.75	\$ 1,183.75
40		\$ 1,805.00	
245	MINOR HAZARD	\$ 14,877.50	\$ 11,392.50
80		\$ 3,485.00	
105	MINOR HAZARD	\$ 4,408.75	\$ 903.75
80		\$ 3,505.00	
35	MINOR HAZARD	\$ 2,732.50	\$ 1,627.50
24		\$ 1,105.00	

\$ 268,049.50
\$ -

		1	1,348.75		
		1	410.75		
		1	540.75		
		1	2,988.75		
		1	14,877.50		
		1	4,408.75		
		1	2,732.50		


\$ - \$ 28,988.75 \$ 239,060.75
\$ - \$ - \$ -
\$ - \$ 28,988.75 \$ 239,060.75


\$ 76,082.00 \$ 160,797.75 \$ 31,169.75

\$ 268,049.50
\$ -
\$ 268,049.50

DUMAINE STREET

OWNER	0	MAJOR HAZARD	2
SWB	6	HAZARD	20
OTHER	18	MINOR HAZARD	2
	24		24

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
Dumaine 1029 (900 N Rampart)	CONCRETE	SUBSIDED CURB AND WALK 8' X 100' REMOVE REPLACE ALL.	 MAJOR HAZARD		800			\$ 13,368.75	\$ 6,463.75									
					160				\$ 6,905.00						1	-	-	13,368.75
Dumaine 1025	CONCRETE	SUBSIDED CURB AND WALK 9' X 30' REMOVE REPLACE ALL	 HAZARD		270			\$ 7,428.75	\$ 2,223.75									
					120				\$ 5,205.00						1	-	7,428.75	-
Dumaine 1001. Hotel st Pierre	CONCRETE	SUBSIDED CURB AND WALK REMOVE REPLACE 5' X 9' WALK	 HAZARD		45			\$ 2,228.75	\$ 423.75									
					40				\$ 1,805.00						1	-	2,228.75	-

Dumaine 539	BRICK	REPLACE AND REGROUT BRICK PAVERS AT SWB ACCESS 6' X 6'	HAZARD	
Dumaine 1040	CONCRETE	Repair walk at MH cover 4'x6'	HAZARD	
Dumaine 1022 1026	CONCRETE	Replace subsided concrete walk and curb 25'x7'	HAZARD	
Dumaine 1014	CONCRETE	Replace subsided concrete walk and curb 40'x7'	HAZARD	
Dumaine 1002	CONCRETE	Reinstall Ballard or remove and fill.	MINOR HAZARD	
Dumaine 936	CONCRETE	Replace 75'x7' subsided concrete walk and curb.	HAZARD	
Dumaine 916	CONCRETE	Replace subsided concrete walk and curb 45'x7'	HAZARD	
Dumaine 902 - 906	CONCRETE	Remove subsided walk and curb replace, 75' x 7'.	HAZARD	
Dumaine 700	CONCRETE	Remove stump restore concrete walk 2'x4' AT 3 LOCATIONS	HAZARD	
Dumaine 634	CONCRETE	Replace concrete walk at fire hydrant 5'x5'	HAZARD	

36

40

24

12

175

40

280

80

1

1

525

240

315

200

525

240

24

24

25


8

	MATERIAL	\$ 3,459.00	\$ 1,674.00
	LABOR	\$ 1,785.00	
	MATERIAL	\$ 870.75	\$ 255.75
	LABOR	\$ 615.00	
	MATERIAL	\$ 3,268.75	\$ 1,463.75
	LABOR	\$ 1,805.00	
	MATERIAL	\$ 5,808.75	\$ 2,303.75
	LABOR	\$ 3,505.00	
	MATERIAL	\$ 219.25	\$ 71.75
	LABOR	\$ 147.50	
	MATERIAL	\$ 14,568.75	\$ 4,263.75
	LABOR	\$ 10,305.00	
	MATERIAL	\$ 11,188.75	\$ 2,583.75
	LABOR	\$ 8,605.00	
	MATERIAL	\$ 14,568.75	\$ 4,263.75
	LABOR	\$ 10,305.00	
	MATERIAL	\$ 1,380.75	\$ 255.75
	LABOR	\$ 1,125.00	
	MATERIAL	\$ 708.75	\$ 263.75
	LABOR	\$ 445.00	

		1	-	3,459.00	-
\$					
		1	-	870.75	-
\$					
		1	-	3,268.75	-
\$					
		1	-	5,808.75	-
\$					
		1	219.25	-	-
\$					
		1	-	14,568.75	-
\$					
		1	-	11,188.75	-
\$					
		1	-	14,568.75	-
\$					
		1	-	1,380.75	-
\$					
		1	-	708.75	-
\$					

MADISON ALLEY

OWNER	0	MAJOR HAZARD	0
SWB	0	HAZARD	6
OTHER	6	MINOR HAZARD	0
	6		6



Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER		MINOR	HAZARD	MAJOR
Madison 539	CONCRETE	Replace subsided walk and curb 20'x7'	HAZARD		140			\$ 4,688.75	\$ 1,183.75						1		-	4,688.75	-
					80				\$ 3,505.00										
Madison 536	CONCRETE	Replace subsided 25'x7' concrete walk and reset granite curb	HAZARD		175			\$ 6,668.75	\$ 1,463.75						1		-	6,668.75	-
					120				\$ 5,205.00										
Madison 525	CONCRETE	Replace 25'x7' concrete walk	HAZARD		175			\$ 6,668.75	\$ 1,463.75						1		-	6,668.75	-
					120				\$ 5,205.00										
Madison 522	CONCRETE	Replace 35'x7' concrete walk.	HAZARD		245			\$ 8,928.75	\$ 2,023.75						1		-	8,928.75	-
					160				\$ 6,905.00										
Madison 509	CONCRETE	Replace 35'x7' concrete walk.	HAZARD		245			\$ 8,928.75	\$ 2,023.75						1		-	8,928.75	-
					160				\$ 6,905.00										
Madison 504	CONCRETE	Replace 35'x7' concrete walk	HAZARD		245			\$ 8,928.75	\$ 2,023.75						1		-	8,928.75	-
					160				\$ 6,905.00										
								\$ -	\$ -										
									\$ -										

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

\$ 44,812.50	\$ -	\$ -	\$ 44,812.50	\$ -	\$ 44,812.50	\$ -	\$ 44,812.50
\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
\$ -	\$ -	\$ -	\$ 44,812.50	\$ -	\$ -	\$ -	\$ 44,812.50

ST ANN STREET

OWNER 0 MAJOR HAZARD 0
SWB 2 HAZARD 4
OTHER 5 MINOR HAZARD 3
7

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
St Ann 600	SLATE	REPLACE MISSING SLATE TIELS REGROUT 22' X 12' WALK.	HAZARD				5	\$ 1,970.00	\$ 145.00						1	-	1,970.00	-
							40		\$ 1,825.00									
St Ann 940	SLATE	REPLACE MISSING TILE REGROUT 10' X 4' WALK	HAZARD				8	\$ 1,326.00	\$ 181.00						1	-	1,326.00	-
							24		\$ 1,145.00									
St Ann 1038	CONCRETE	REMOVE REPLACE CURB AND WALK AT 8' X 50' SUBSIDED CONDITION.	HAZARD			400		\$ 5,068.75	\$ 3,263.75						1	-	5,068.75	-
						40			\$ 1,805.00									
St Ann 800 Blk	SLATE	Under construction!						\$ -	\$ -							-	-	-
									\$ -									
St Ann 917	SLATE	Replace 2'x2' slate tile	MINOR HAZARD				2	\$ 404.00	\$ 109.00						1	404.00	-	-
							4		\$ 295.00									
St Ann 1001	CONCRETE	Remove replace damaged concrete walk 4'x4' at MH cover.	HAZARD			16		\$ 976.75	\$ 191.75					1	-	-	976.75	-
						16			\$ 785.00									
St Ann 1025	CONCRETE	Fill abandoned meter port 12" dia x 12" deep	MINOR HAZARD				1	\$ 167.50	\$ -					1	-	167.50	-	-
									\$ 167.50									
St Ann 1031		Fill abandoned drainage ports. 2 ea. 6" dia 12" do.	MINOR HAZARD				2	\$ 210.00	\$ -						1	210.00	-	-
									\$ 210.00									
								\$ -	\$ -							-	-	-
									\$ -									

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

\$ 10,123.00
\$ -
\$ - \$ 1,144.25 \$ 8,978.75 \$ 781.50 \$ 9,341.50 \$ - \$ 10,123.00
\$ - \$ - \$ - \$ - \$ - \$ - \$ - \$ 10,123.00
\$ - \$ 1,144.25 \$ 8,978.75 \$ - \$ - \$ - \$ - \$ 10,123.00

ORLEAN STREET

OWNER	0	MAJOR HAZARD	0
SWB	3	HAZARD	3
OTHER	1	MINOR HAZARD	1
	4		4

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
Orleans 933	BRICK	FILL ABANDONED METER BOX. FILL WITH CONCRETE AND BRICK OVER	HAZARD		4			\$ 611.00	\$ 186.00									
					8				\$ 425.00					1			611.00	
Orleans 835	BRICK	REPLACE MISSING BRICK PAVERS AT METER.	HAZARD		40			\$ 2,455.00	\$ 1,860.00									
					12				\$ 595.00					1			2,455.00	
Orleans 811	BRICK	REMOVE REPLACE BRICK AND CURB AT GUTTER REGROUT .	HAZARD		20			\$ 2,035.00	\$ 930.00									
					24				\$ 1,105.00						1		2,035.00	
Orleans 810	BRICK	Reset brick level w SWB access plate 1'x3'	MINOR HAZARD		2			\$ 348.00	\$ 93.00								348.00	
					4				\$ 255.00					1				
								\$ -	\$ -									
									\$ -									

REPAIRS NEEDED	\$ 5,449.00	\$ -	\$ 3,414.00	\$ 2,035.00	\$ 348.00	\$ 5,101.00	\$ -	\$ 5,449.00
REPAIRS COMPLETE	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -	\$ -
REMAINDER		\$ -	\$ 3,414.00	\$ 2,035.00				\$ 5,449.00

ST PETERS STREET

OWNER	0	MAJOR HAZARD	0
SWB	4	HAZARD	9
OTHER	11	MINOR HAZARD	6
	15		15

[illegible]

St Peter 936	BRICK	Replace missing drain access cover plate SWB	HAZARD	
St Peter 900	BRICK	Replace thin set Brick tiles 2'x3'	MINOR HAZARD	
St Peter 836	BRICK	Non compliant repair, remove replace w 4'x4' brick pavers	MINOR HAZARD	
St Peter 736	SLATE	Replace and grout two location 2'x4'	HAZARD	
St Peter 734	SLATE	Reset and grout 2' x 3' slate tiles.	HAZARD	
St Peter 726	SLATE	Replace 1'x2' Slate tile, regrout 2'x7' walk.	HAZARD	
St Peter 618	SLATE	Reset and grout slate tiles 5'x3'	MINOR HAZARD	

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

0	LABOR	\$ 127.50	\$ -
1	MATERIAL	\$ -	\$ 127.50
6	LABOR	\$ 534.00	\$ 279.00
4	MATERIAL	\$ -	\$ 255.00
32	LABOR	\$ 2,593.00	\$ 1,488.00
24	MATERIAL	\$ -	\$ 1,105.00
16	LABOR	\$ 1,252.00	\$ 277.00
20	MATERIAL	\$ -	\$ 975.00
6	LABOR	\$ 792.00	\$ 157.00
12	MATERIAL	\$ -	\$ 635.00
1	LABOR	\$ 1,072.00	\$ 97.00
20	MATERIAL	\$ -	\$ 975.00
1	LABOR	\$ 732.00	\$ 97.00
12	MATERIAL	\$ -	\$ 635.00
	LABOR	\$ -	\$ -
	MATERIAL	\$ -	\$ -

\$ 21,719.75
\$ -

1	\$ -	\$ 127.50	\$ -
1	\$ -	\$ 534.00	\$ 279.00
1	\$ -	\$ 2,593.00	\$ 1,488.00
1	\$ -	\$ 1,252.00	\$ 277.00
1	\$ -	\$ 792.00	\$ 157.00
1	\$ -	\$ 1,072.00	\$ 97.00
1	\$ -	\$ 732.00	\$ 97.00
	\$ -	\$ -	\$ -

\$ - \$ 4,227.25 \$ 17,492.50
\$ - \$ - \$ -
\$ - \$ 4,227.25 \$ 17,492.50

\$ 10,285.50 \$ 11,434.25 \$ -
\$ -
\$ 21,719.75

WILKINSON ALLY

OWNER
SWB
OTHER

0 MAJOR HAZARD
0 HAZARD
0 MINOR HAZARD
0

0
0
0
0

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	SWB	OTHER		MINOR	HAZARD	MAJOR
WILLKINSON	BRICK	NONE	NO HAZARD					\$ -	\$ -									
									\$ -			\$ -						
								\$ -	\$ -									
								\$ -	\$ -									
								\$ -	\$ -									
								\$ -	\$ -									
								\$ -	\$ -									

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER


\$ -
\$ -

\$ - \$ - \$ -
\$ - \$ - \$ -
\$ - \$ - \$ -

\$ -
\$ -
\$ -

TOULOUSE STREET

OWNER	0	MAJOR HAZARD	0
SWB	3	HAZARD	7
OTHER	9	MINOR HAZARD	5
	12		12

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
Toulouse St 910	BRICK	replace and grout Brck at SWB Metter box. 3' x 5'	 Hazard		12			\$ 813.00	\$ 558.00					1		-	813.00	-
					4				\$ 255.00			\$						
Toulouse 740	SLATE	Repair Repalce 40% of Slate at Walk 9' x 40' regROUT all.	 Hazard				60	\$ 2,630.00	\$ 805.00							-	2,630.00	-
							40		\$ 1,825.00			\$						
Toulouse 640	SLATE	Replace Slate Tiles 2' x 3' 4 tiles.	 Hazard				4	\$ 768.00	\$ 133.00							-	768.00	-
							12		\$ 635.00			\$						
Toulouse 620	SLATE	UNDER REPAIR	 Hazard					\$ -	\$ -							-	-	-
									\$ -			\$						
Toulouse 606	SLATE	Fill hole in slate walk 6' x 6' 4' deep	 Hazard				1	\$ 392.00	\$ 97.00							-	392.00	-
							4		\$ 295.00			\$						
Toulouse 601	SLATE	REPLACE TILE AT SWB ;METER REPAIR.	 Hazard				1	\$ 392.00	\$ 97.00							-	392.00	-
							4		\$ 295.00			\$						
Toulouse 506	SLATE	Replace slate tile 3'x3'	 MINOR HAZARD				9	\$ 998.00	\$ 193.00							998.00	-	-
							16		\$ 805.00			\$						
Toulouse 603	SLATE	SWB repair replace slate are meter 3'x3'	 MINOR HAZARD				9	\$ 658.00	\$ 193.00					1		658.00	-	-
							8		\$ 465.00			\$						
Toulouse 719	SLATE	Replace 3 broken slate tiles regROUT 7'x12' area	 MINOR HAZARD				84	\$ 2,238.00	\$ 1,093.00							2,238.00	-	-
							24		\$ 1,145.00			\$						
Toulouse 735	SLATE	RegROUT 7'x 35' slate walk replace 4 missing tiles	 MINOR HAZARD				12	\$ 2,054.00	\$ 229.00							2,054.00	-	-
							40		\$ 1,825.00			\$						

Toulouse 801	BRICK	Replace 4 missing brick regROUT 7x12' area.	 MINOR HAZARD	
Toulouse 811	BRICK	Replace brick pavers @ SWB access 3'x3'	 Hazard	
Toulouse 915	BRICK	Replace tree or fill 3'x3' brick planter.	 Hazard	
Toulouse 1039	BRICK	Under construction	 MINOR HAZARD	

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

MATERIAL	\$ 1,924.50	\$ 139.50
LABOR		\$ 1,785.00
MATERIAL	\$ 1,183.50	\$ 418.50
LABOR		\$ 765.00
MATERIAL	\$ 1,183.50	\$ 418.50
LABOR		\$ 765.00
MATERIAL	\$ -	\$ -
LABOR		\$ -
MATERIAL	\$ -	\$ -
LABOR		\$ -

		1
		1
		1

\$ 15,234.50	\$ -	\$ 2,654.50	\$ 12,580.00	\$ 7,872.50	\$ 7,362.00	\$ -	\$ 15,234.50
\$ -	\$ -	\$ -	\$ -				\$ -
	\$ -	\$ 2,654.50	\$ 12,580.00				\$ 15,234.50

ST LOUIS STREET

OWNER	0	MAJOR HAZARD	0
SWB	2	HAZARD	12
OTHER	10	MINOR HAZARD	0
	12		12

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE		Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER		MINOR	HAZARD	MAJOR	
St Louis 926	BRICK	SWB REPAIR BRICK WALK AT METER S 4' X 9'			40			MATERIAL	\$ 4,495.00	\$ 1,860.00						1		-	4,495.00	-	
					60			LABOR		\$ 2,635.00				\$							
St Louis 920	BRICK	REPLACE MISSION 10 BRICKS REGROUT WALK AT DRIVE WAY			16			MATERIAL	\$ 1,849.00	\$ 744.00							1	-	1,849.00	-	
					24			LABOR		\$ 1,105.00				\$							
St Louis 800	BRICK	REPLACE 2 BRICK REGROUT 2'X4' WALK			8			MATERIAL	\$ 627.00	\$ 372.00							1	-	627.00	-	
					4			LABOR		\$ 255.00				\$							
St Louis 730	SLATE	RESET COX ACCESS BOLX TO WALK ELEVATION					8	MATERIAL	\$ 646.00	\$ 181.00							1	-	646.00	-	
							8	LABOR		\$ 465.00				\$							
St Louis 714	SLATE	REJPLACE MISSING TILE REQROUT 3' X 6' WALK					18	MATERIAL	\$ 936.00	\$ 301.00								1	-	936.00	-
							12	LABOR		\$ 635.00				\$							
St Louis 600	SLATE	REPLACE MISSIONG 12" X 20" TILE					2	MATERIAL	\$ 404.00	\$ 109.00								1	-	404.00	-
							4	LABOR		\$ 295.00				\$							
St Louis 500	BRICK	REPLACE 3 BRICK PAVERS REGROUT			3			MATERIAL	\$ 394.50	\$ 139.50								1	-	394.50	-
					4			LABOR		\$ 255.00				\$							
St Louis 541	SLATE	REPLACE 18" X 18" TILE					1	MATERIAL	\$ 392.00	\$ 97.00								1	-	392.00	-
							4	LABOR		\$ 295.00				\$							
St Louis 735	SLATE	FILL TWO HOLES IN SLATE TILES, 4" DIA					2	MATERIAL	\$ 319.00	\$ 109.00								1	-	319.00	-
							2	LABOR		\$ 210.00				\$							
St Louis 831	BRICK	FILL 5" DIA HOLE IN BRICK PAVERS			1			MATERIAL	\$ 174.00	\$ 46.50								1	-	174.00	-
					1			LABOR		\$ 127.50				\$							
St Louis 1007	BRICK	Reconstruct planter grill around two trees reset brick 4'x4' & 6'x6'			20			MATERIAL	\$ 2,715.00	\$ 930.00								1	-	2,715.00	-
					40			LABOR		\$ 1,785.00				\$							

St Louis 1025	BRICK	SWB REPAIR BRICK AT METER 4'X 4'	 Hazard	

16
20

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

LARGE MATERIAL	LARGE MATERIAL	
	\$ 1,679.00	\$ 744.00
		\$ 935.00
	\$ -	\$ -
		\$ -

\$ 14,630.50
\$ -

	1	
	\$	
	\$	

\$ - \$ 6,174.00 \$ 8,456.50
\$ - \$ - \$ -
\$ - \$ 6,174.00 \$ 8,456.50


- 1,679.00 -

\$ 14,630.50
\$ -
\$ 14,630.50

Conti 601	SLATE	NON CONFORMING REPAIR (ASPHALT) AT SIDEWALK REPLACE 24'X6' WITH SLATE TILE	MINOR HAZARD		
Conti 601	SLATE	NON CONFORMING REPAIR (ASPHALT) AT SIDEWALK REPLACE 24'X6' WITH SLATE TILE	MINOR HAZARD	●	
Conti 513	SLATE	Replace tile 18"x18" regout 6'x8'	HAZARD	●	
Conti 518	SLATE	Replace slate tiles 5' x 8' and regout.	HAZARD	●	
Conti 604	SLATE	NON CONFORMING REPAIR (ASPHALT) AT SIDEWALK REPLACE 6' x 8' WITH SLATE TILE	MINOR HAZARD	●	
Conti 618	SLATE	NON CONFORMING REPAIR (ASPHALT) AT SIDEWALK REPLACE 8' x 8' WITH SLATE TILE	MINOR HAZARD	●	
Conti 640	SLATE	NON CONFORMING REPAIR (ASPHALT) AT SIDEWALK REPLACE 8' x 8' WITH SLATE TILE	MINOR HAZARD	●	
Conti 700	SLATE	NON CONFORMING REPAIR (ASPHALT) AT SIDEWALK REPLACE 8' x 6' WITH SLATE TILE	MINOR HAZARD	●	
Conti 700	SLATE	repair replace tiles at loading dock 6' x 24'	HAZARD	●	
Conti 700	SLATE	NON CONFORMING REPAIR (ASPHALT) AT SIDEWALK REPLACE 2 ea 2x2' & 1 ea 8'x8' WITH SLATE TILE	MINOR HAZARD	●	

150	LABOR	\$ 5,410.00	\$ 1,885.00	
80	MATERIAL		\$ 3,525.00	
150	LABOR	\$ 5,410.00	\$ 1,885.00	
80	MATERIAL		\$ 3,525.00	
48	LABOR	\$ 2,486.00	\$ 661.00	
40	MATERIAL		\$ 1,825.00	
40	LABOR	\$ 1,370.00	\$ 565.00	
16	MATERIAL		\$ 805.00	
48	LABOR	\$ 1,806.00	\$ 661.00	
24	MATERIAL		\$ 1,145.00	
65	LABOR	\$ 2,350.00	\$ 865.00	
32	MATERIAL		\$ 1,485.00	
65	LABOR	\$ 2,350.00	\$ 865.00	
32	MATERIAL		\$ 1,485.00	
48	LABOR	\$ 1,806.00	\$ 661.00	
24	MATERIAL		\$ 1,145.00	
150	LABOR	\$ 4,560.00	\$ 1,885.00	
60	MATERIAL		\$ 2,675.00	
75	LABOR	\$ 3,660.00	\$ 985.00	
60	MATERIAL		\$ 2,675.00	

				5,410.00	-	-
			1			
				5,410.00	-	-
			1			
				-	2,486.00	-
			1			
				-	1,370.00	-
			1			
				1,806.00	-	-
			1			
				2,350.00	-	-
			1			
				2,350.00	-	-
			1			
				1,806.00	-	-
			1			
				-	4,560.00	-
			1			
				3,660.00	-	-
			1			

Conti 740	SLATE	NON CONFORMING REPAIR (ASPHALT) AT SIDEWALK REPLACE 8'x6' WITH SLATE TILE	MINOR HAZARD	
Conti 804	BRICK	Replace brick pavers at walk 8' x 12'	HAZARD	
Conti 810	BRICK	Replace brick pavers at walk 8' x 12'	HAZARD	
Conti 814	BRICK	replace tree at grillage	MINOR HAZARD	
Conti 830	BRICK	replace tree at grillage	MINOR HAZARD	
Conti 1026	BRICK	replace 15 bad brick regROUT 4' x 4' area	MINOR HAZARD	
Conti 1040	BRICK	replace missing brick at post 4' x 6'	HAZARD	

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

48	LABOR	\$ 1,806.00	\$ 661.00
24	MATERIAL		\$ 1,145.00
100	LABOR	\$ 8,135.00	\$ 4,650.00
80	MATERIAL		\$ 3,485.00
100	LABOR	\$ 8,135.00	\$ 4,650.00
80	MATERIAL		\$ 3,485.00
24	LABOR	\$ 1,105.00	\$ -
	MATERIAL		\$ 1,105.00
24	LABOR	\$ 1,105.00	\$ -
	MATERIAL		\$ 1,105.00
16	LABOR	\$ 1,806.50	\$ 744.00
23	MATERIAL		\$ 1,062.50
16	LABOR	\$ 1,339.00	\$ 744.00
12	MATERIAL		\$ 595.00
	LABOR	\$ -	\$ -
	MATERIAL		\$ -

\$ 72,849.50
\$ -

			1	1,806.00	-	-
			1	-	8,135.00	-
			1	-	8,135.00	-
			1	1,105.00	-	-
			1	1,105.00	-	-
			1	1,806.50	-	-
			1	-	1,339.00	-

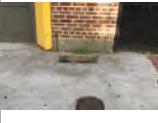
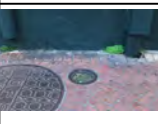
\$ - \$ 3,310.00 \$ 69,539.50
\$ - \$ - \$ -
\$ - \$ 3,310.00 \$ 69,539.50

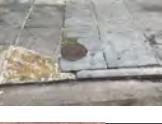
\$ 44,160.50 \$ 28,689.00 \$ -

\$ 72,849.50
\$ -
\$ 72,849.50

BIENVILLE STREET

OWNER 0 MAJOR HAZARD 0
SWB 3 HAZARD 9
OTHER 14 MINOR HAZARD 8
17 17

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	SWB	OTHER	MINOR	HAZARD	MAJOR
Bienville 412	BRICK	Replace sidewalk brick 1.5'x4'	HAZARD		6			\$ 704.00	\$ 279.00					1	-	704.00	-
					8				\$ 425.00								
Bienville 536	SLATE	Replace regout slate tiles 5'x7'	HAZARD				35	\$ 2,330.00	\$ 505.00					1	-	2,330.00	-
							40		\$ 1,825.00								
Bienville 606	SLATE	Replace Slate tiles 2'x4'	MINOR HAZARD				6	\$ 622.00	\$ 157.00					1	622.00	-	-
							8		\$ 465.00								
Bienville 750	SLATE	Reset subsided Slate tiles 3'x5'	MINOR HAZARD				15	\$ 730.00	\$ 265.00					1	730.00	-	-
							8		\$ 465.00								
Bienville 778	SLATE	Reset slate tiles regout 5'x5' replace 3 tiles	MINOR HAZARD				25	\$ 1,020.00	\$ 385.00					1	1,020.00	-	-
							12		\$ 635.00								
Bienville 924	CONCRETE	Missing Cox junction box lid 1'x2'	HAZARD				0	\$ 167.50	\$ -					1	-	167.50	-
							1		\$ 167.50								
Bienville 1025	BRICK	Missing 8" cover plate SWB	MINOR HAZARD					\$ 167.50	\$ -					1	167.50	-	-
							1		\$ 167.50								
Bienville 937	BRICK	Missing 8" cover plate SWB	MINOR HAZARD					\$ 167.50	\$ -					1	167.50	-	-
							1		\$ 167.50								

Bienville 711	SLATE	Remove replace subsided slate tiles 5'x5' at SWB man hole	HAZARD	
Bienville 539	SLATE	Replace 3' granite CURB and 4'x1' slate tile	HAZARD	
Bienville 531	SLATE	Replace two 1'x2' slate tiles	MINOR HAZARD	
Bienville 515	SLATE	Replace slate tile 1'x1'.	MINOR HAZARD	
Bienville 501	SLATE	Fill 12"x12" hole in slate tile replace missing granite curb stone 6'	HAZARD	
Bienville 340	CONCRETE	UNDER CONSTRUCTION	MINOR HAZARD	
Bienville 331	BRICK	Replace holly oak in brick planter 4'x4'	HAZARD	
Bienville 330	BRICK	Replace Holly Oak 4'x4' planter	HAZARD	
Bienville 320	BRICK	Non compliant repair brick pavers 4'x5'	HAZARD	

16

8

16

8

20

16

25	LABOR	MATERIAL	\$ 1,190.00	\$ 385.00
16				\$ 805.00
4	LABOR	MATERIAL	\$ 598.00	\$ 133.00
8				\$ 465.00
4	LABOR	MATERIAL	\$ 598.00	\$ 133.00
8				\$ 465.00
1	LABOR	MATERIAL	\$ 307.00	\$ 97.00
2				\$ 210.00
6	LABOR	MATERIAL	\$ 622.00	\$ 157.00
8				\$ 465.00
	LABOR	MATERIAL	\$ -	\$ -
				\$ -
16	LABOR	MATERIAL	\$ 1,169.00	\$ 744.00
8				\$ 425.00
16	LABOR	MATERIAL	\$ 1,169.00	\$ 744.00
8				\$ 425.00
20	LABOR	MATERIAL	\$ 1,695.00	\$ 930.00
16				\$ 765.00

		1	-	1,190.00	-
		1	-	598.00	-
		1	598.00	-	-
		1	307.00	-	-
		1	-	622.00	-
		1	-	1,169.00	-
		1	-	1,169.00	-
		1	-	1,695.00	-

IBERVILLE STREET

OWNER	2	MAJOR HAZARD	1
SWB	3	HAZARD	13
OTHER	12	MINOR HAZARD	3
	17		17

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	OWNER	SWB	OTHER	MINOR	HAZARD	MAJOR
Iberville 901	BRICK	Remove sign post remnant fill, replace missing brick regROUT 1'x2'	HAZARD		2			\$ 348.00	\$ 93.00									
					4													
Iberville 817	BRICK	Two areas 5'x7' and 10'x7' walk, replace 8 brick, reset meters level w Walk, regROUT.	HAZARD		15			\$ 2,482.50	\$ 697.50									
					40													
Iberville 733	BRICK	Replace non standard patch with 4'x5' brick pavers	MINOR HAZARD		20			\$ 2,035.00	\$ 930.00							2,035.00		
					24													
Iberville 539	BRICK	Remove and replace 6'x8' brick walk.	HAZARD		48			\$ 3,337.00	\$ 2,232.00									
					24													
Iberville 535	BRICK	Install 35'x7' brick sidewalk, under construction	HAZARD		245			\$ 19,977.50	\$ 11,392.50									
					200													
Iberville 527 529	BRICK	Remove plywood temporary fix, install brick pavers. 4'x65'	HAZARD		260			\$ 18,975.00	\$ 12,090.00									
					160													
Iberville 519	BRICK	Install brick 3'x3' at light pole, owner has marshaled material to fix later this week.	HAZARD		9			\$ 1,013.50	\$ 418.50					1			1,013.50	
					12													
Iberville 109	BRICK	Two vertical pvc 8" dia pipe on walk (likely sign post voids) patch or install sign standards	HAZARD		2			\$ 348.00	\$ 93.00									
					4													

Iberville 404	BRICK	Replace cast iron planter cover 5'x5'	HAZARD		20
Iberville 540	BRICK	Under construction	HAZARD		4
Iberville 600	BRICK	RegROUT 2'x12' brick pavers	MINOR HAZARD		24
Iberville 640 (134 Royal St)	BRICK	Fill abandoned termite trap holes 3 ea. Remove bolt trip hazard 2 ea. RegROUT brick walk 5'x5'. Replace 8" cover plate.	MAJOR HAZARD		4
Iberville 700	BRICK	Replace damaged utility cover plate. Reset box flush w walk. 2'x1'	HAZARD		2
Iberville 720	BRICK	Replace 8" dia cover plate	HAZARD		1
Iberville 740 (140 Bourbon St)	BRICK	Replace brick, regROUT joint 7' x 1'	HAZARD		4
Iberville 800	BRICK	Replace missing brick fill between curb and Cox box	HAZARD		4
Iberville 820	BRICK	Replace regROUT 2 bricks 1' x4'	HAZARD		2

MATERIAL	\$ 1,185.00	\$ 930.00
LABOR		\$ 255.00
MATERIAL	\$ -	\$ -
LABOR		\$ -
MATERIAL	\$ 1,371.00	\$ 1,116.00
LABOR		\$ 255.00
MATERIAL	\$ 611.00	\$ 186.00
LABOR		\$ 425.00
MATERIAL	\$ 348.00	\$ 93.00
LABOR		\$ 255.00
MATERIAL	\$ 301.50	\$ 46.50
LABOR		\$ 255.00
MATERIAL	\$ 301.50	\$ 46.50
LABOR		\$ 255.00
MATERIAL	\$ 441.00	\$ 186.00
LABOR		\$ 255.00
MATERIAL	\$ 348.00	\$ 93.00
LABOR		\$ 255.00

		1	-	1,185.00	-
\$					
\$					
		1	1,371.00	-	-
\$					
	1		-	-	611.00
\$					
	1		-	348.00	-
\$					
	1		-	301.50	-
\$					
	1		-	301.50	-
\$					
	1		-	441.00	-
\$					
	1		-	348.00	-
\$					

Iberville 940 Ritz	BRICK	Replace non standard utility (Cox) cover. 2'x3'	MINOR HAZARD	
Iberville 1000 block		No access Hardrock Hotel Demo.		

12

12

REPAIRS NEEDED
REPAIRS COMPLETE
REMAINDER

MATERIAL	\$ 1,153.00	\$ 558.00
LABOR		\$ 595.00
MATERIAL	\$ -	\$ -
LABOR		\$ -
MATERIAL	\$ -	\$ -
LABOR		\$ -

\$ 54,576.50
\$ -

	1	

1,153.00 - -

\$ 1,624.50 \$ 1,802.50 \$ 51,149.50
\$ - \$ - \$ -
\$ 1,624.50 \$ 1,802.50 \$ 51,149.50

\$ 4,559.00 \$ 49,406.50 \$ 611.00

\$ 54,576.50
\$ -
\$ 54,576.50

CANAL STREET QTR SIDE

OWNER 0 MAJOR HAZARD 0
SWB 1 HAZARD 5
OTHER 6 MINOR HAZARD 2
7 7

Location	Material	Hazard	Hazard Assessment	Current Picture	BRICK	CONC	SLATE	Repair Cost	Repair Cost	DATE	STATUS	\$ COMPLETE	SWB	OTHER	MINOR	HAZARD	MAJOR
Canal 619 - 615	BRICK	Replace 20' X 4" trench drain cast iron cover	HAZARD		6			\$ 534.00	\$ 279.00					1	-	534.00	-
					4				\$ 255.00								
Canal 711	BRICK	Replace 10 missing brick re-sand 3'x4'	HAZARD		10			\$ 890.00	\$ 465.00					1	-	890.00	-
					8				\$ 425.00								
Canal 739	SLATE	Reset granite pavers regROUT all 12"x20"	MINOR HAZARD				12	\$ 1,204.00	\$ 229.00					1	1,204.00	-	-
							20		\$ 975.00								
Canal 825	SLATE	Repair apparent utility crew damage to walk surfaces. 12'x25'	HAZARD		300			\$20,835.00	\$ 13,950.00					1	-	20,835.00	-
					160				\$ 6,885.00								
Canal 827	BRICK	Replace missing brick, re-sand 2'x12' walk	HAZARD		1			\$ 641.50	\$ 46.50					1	-	641.50	-
					12				\$ 595.00								
Canal 829	BRICK	Reset brick 2'x5'	MINOR HAZARD		4			\$ 611.00	\$ 186.00					1	611.00	-	-
					8				\$ 425.00								
Canal 833	BRICK	Replace 10" dia elec utility cover.	HAZARD		1			\$ 216.50	\$ 46.50					1	-	216.50	-
					2				\$ 170.00								
								\$ -	\$ -								
									\$ -								

REPAIRS NEEDED	\$ 24,932.00	\$ 216.50	\$ 24,715.50	\$ 1,815.00	\$ 23,117.00	\$ -	\$ 24,932.00
REPAIRS COMPLETE	\$ -	\$ -	\$ -				\$ -
REMAINDER		\$ 216.50	\$ 24,715.50				\$ 24,932.00